

CROW WING COUNTY SI07
COUNTY SURVEYOR-1981TIES

No. S-107

CONTRACT S-107

Raymond L. Anderson
Reg. No. 10798

Compass decl. 6° W
All ties horiz. distance to
bottom face blaze unless
otherwise noted.



INDEX

PAGE	CORNER DESCRIPTION
1.	N-6/7 M.C. 45-28
2.	L-5 1/4 45-28
3.	K/L-5 M.C. 45-28
4.	J-6/7 M.C. 45-28
5.	2-13/14 M.C. 45-28
6.	V/2-13 M.C. 45-28
7.	V/2-13 M.C. 45-28
8.	A/3-13 M.C. 44-28
9.	L-1 1/4 45-28
10.	J-3/4 M.C. 45-28
11.	J-3 1/4 45-28
12.	E-1 SEC.COR. 45-28
13.	C-1 1/4 45-28
14.	F/G-5 M.C. 45-28
15.	E-5/6 M.C. 45-28
16.	E-5 SEC.COR. 45-28
17.	E/F-5 M.C. 45-28
	E/F-5 M.C. 45-28
18.	E-7/8 M.C. 45-28
19.	G-1 1/4 45-28
20.	C-5 1/4 45-28
21.	E-24/25 M.C. 45-28
22.	E/F-25 M.C. 45-28


No. S-107

23.	G-5 1/4 44-28
24.	E-5 SEC.COR. 44-28
25.	C-5 1/4 44-28
26.	J-3 1/4 44-28
27.	E-3 1/4 44-28
28.	E-9 SEC.COR. 44-28
29.	B/C-17 M.C. 44-28
30.	C/D-17 M.C. 44-28
31.	E-10/11 M.C. 44-28
32.	G-9 1/4 44-28
33.	E-11 1/4 44-28
34.	G-13 1/4 44-28
35.	E-7 1/4 44-28
36.	N-5 SEC.COR. 44-28
37.	P-5 1/4 44-28
38.	N-7 1/4 44-28
39.	R-3 1/4 44-28
40.	L-5 1/4 44-28
41.	J-5 SEC.COR. 44-28

No. S-107

5-20-81

Ray

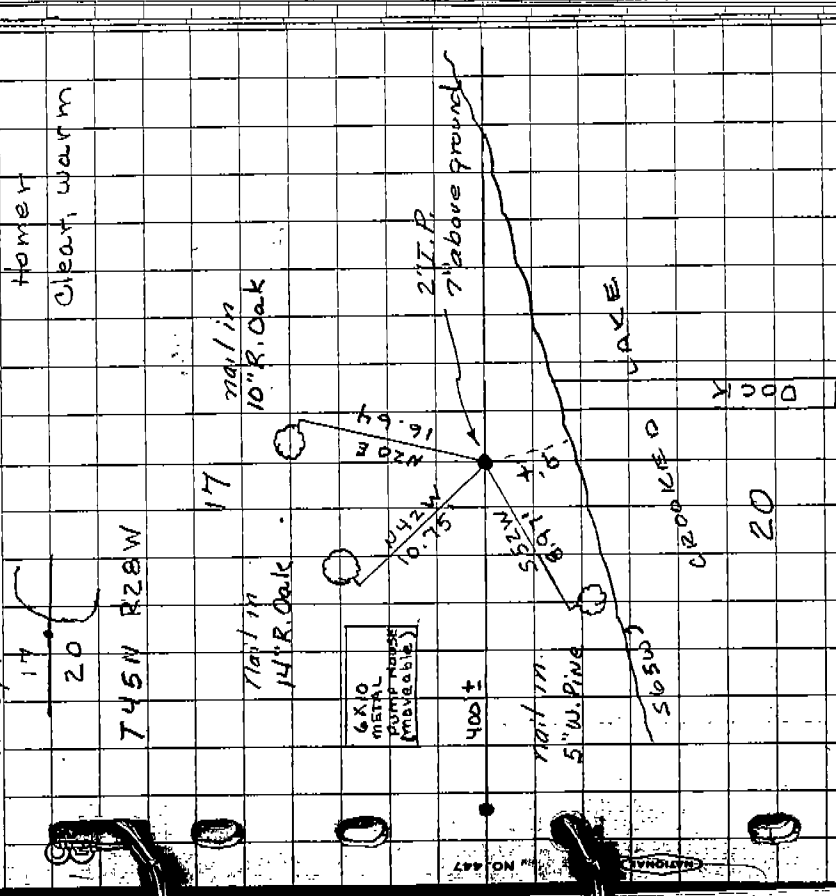

ALL TIES 10\"/>

Time 1 1/2 HR.

N-6/7 M.C. 17-20
T45N R28W

ORIGINAL TIES

9\"/>

NO EVIDENCE FOUND

Found 2\"/>

Did not blaze trees as on developed lakeshore. Used nails in side of trees as shown.

WSN 58/63 65/6 no ties

NO. 107

5-20-81

Ray Homer

4

J-6/7 M.C. } 8/17 T4SN R28W

FOUND I.P. AND EXISTING TIES AS SHOWN! MADE ONE NEW TIE

OLD TIES (W.S.N.) SB/64E 42/16
8" R.O. N43E 45.2' (GONE)
8" N.P. S35 1/2 E 48.8 (IN PLACE)


OLD TIES (W.S.N.) 258/80
5" MAPLE N.E. 11.85 (IN PLACE)
12" N. PINE S.E. 44.65 (IN PLACE)

Book 258/80
M.C. in water
Pipes 17.78 EAST OF TRUE LOCATION.

TIME 2 HRS.
1:30 P.M.

J-6/7 M.C. } 8/17 T4SN R28W

Clear, Warm

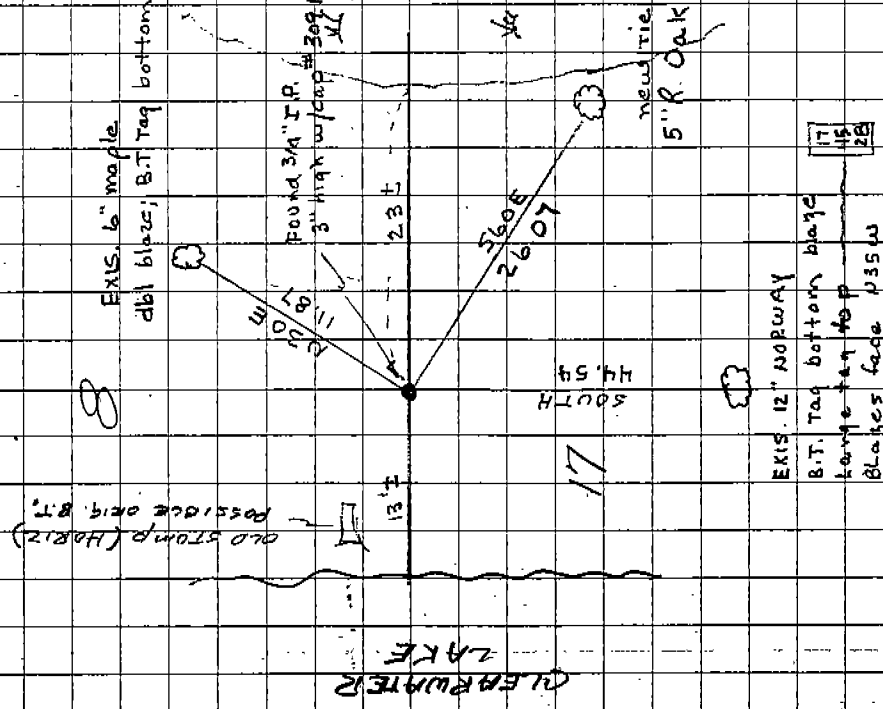

山 王 廟

28-44-28

5-20-81

1/2-13 M.C. T45N R28W

5-20-81 FOUND I.P. AS SHOWN
ON TOP OF BANK TO
LAKE @ 210' N
OF SEC. CORNER, ALSO
AT 246' ON SHORE.

6-4-81 PIPE AT TOP OF BANK
HAS OLD TIE TREES SO
WE TIE OUT AS SHOWN.
ALSO TIE PIPE ON SHORE

NO EVIDENCE OF ORIG.

TIES.

5-20-81 3/4 H.R.
6-4-81 1 1/2 H.R.

No. S-107

1/2-13 M.C.

T45N R28W

6-4-81 5-20-81

Ray Homer
clear warm
clear warm

SCOTT Tipped
LAKE West. Very
1054.
1" pipe 4 1/2" high
1 1/2" T.P. 3 1/2" high
TIES TO 1" PIPE

4" nail in side N82W
5" pipe 1/154
582E
5.68
5.35E
49
nail in side 4" N54
5" pipe 1/154
582E
5.68
5.35E
49
nail in side 4" N54

NO. 447



33

34

NATIONAL

2 1/2" T.P. 5" high

16" Red Oak

588W
30.32

18" BASS.

364E
7.23

EXIS. BOTTOM
BLAZE

P.K. FACE CHASTER POLE

15" N.A.P.E.

EXIS. BOTTOM BLAZE

Y/2-13 M.C.
T45N 228W

5-20-81 FOUND I.P. AS SHOWN
ON TOP OF BANK TO
LAKE

6-4-81 THE OUT EXISTING PIPE
AS SHOWN, BOTH THE
TREES HAD EXISTING
BLAZES

NO EVIDENCE OF ORIG.
TIES

5-20-81 3/4 HR.
6-4-81 1 HR.

33 34

No. S-107


Y/2-13 M.C.
T45N 228W

6-4-81
Ray
Homer
clear
warm

5-20-81
Ray
Homer
clear, warm

OPEN TOP BLAZE - BOTTOM
BLAZE OKS ON 14" DISH

opened old blazes
on 16" R. Oak

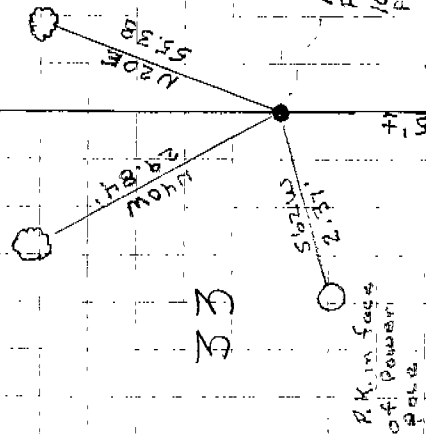

FOUND I.P. D.D.
ROUND IRON ROLLER,
10" high, STEEL PLATE
FAST along side

9-13-51

No. S-107

6-4-51

A/B-13 M.C.
T44N-R28W

4-3

A/B-13 M.C.
T44N R28W

4-3

Ray
Homer
clear, warm

TAPE SOUTH FROM
SECTION CORNER IN
PLACE ON TWP LINE
97'± THIS POSITION
IS AT LEAST 100'±
FROM LAKE, AND 30'±
IN ELEVATION FROM
WATER. I QUESTION
THE B24 TREES AS
BEING TAMARACK IN
THIS AREA. —

NOTHING FOUND
—

TIME 1 1/2 HR.

L-1 1/4 COR.

13 18
45 45
29 28

TAPE SOUTH FROM N.W.
CORNER SEC. 18 (PIPE IN
PLACE - OAK TREE S.W. &
PINE TREE SE) at 2370
leave field and enter
woods. Find 2 fences
as shown. Found 2
PINCH TOP PIPE 9" DIA.
NO OR G. BROTTES FOUND.
NO EXISTING TREE
FOUND FOR PINCH TOP PIPE.

JUNE 10, 1981

VISITED WITH NELS JOHANSON
AND HIS WIFE. HE REMEMBERS
IN 1949 OR 1950 HE HAD HIS
PROPERTY SURVEYED. PRIOR TO
FENCE BUILDING, HE THINKS IT
WAS HOLMSTROM THAT DID THE
WORK AND SO SET THIS CORNER
ALSO 1/16 COR. TO NORTH.

TIME 3 1/2 HRS.


JUNE 10 ~ 1 HR.

No. 3-107

L-1 1/4 COR.

13 18
45 45
29 28

6-8-81
Ray
Homer
cloudy - warm

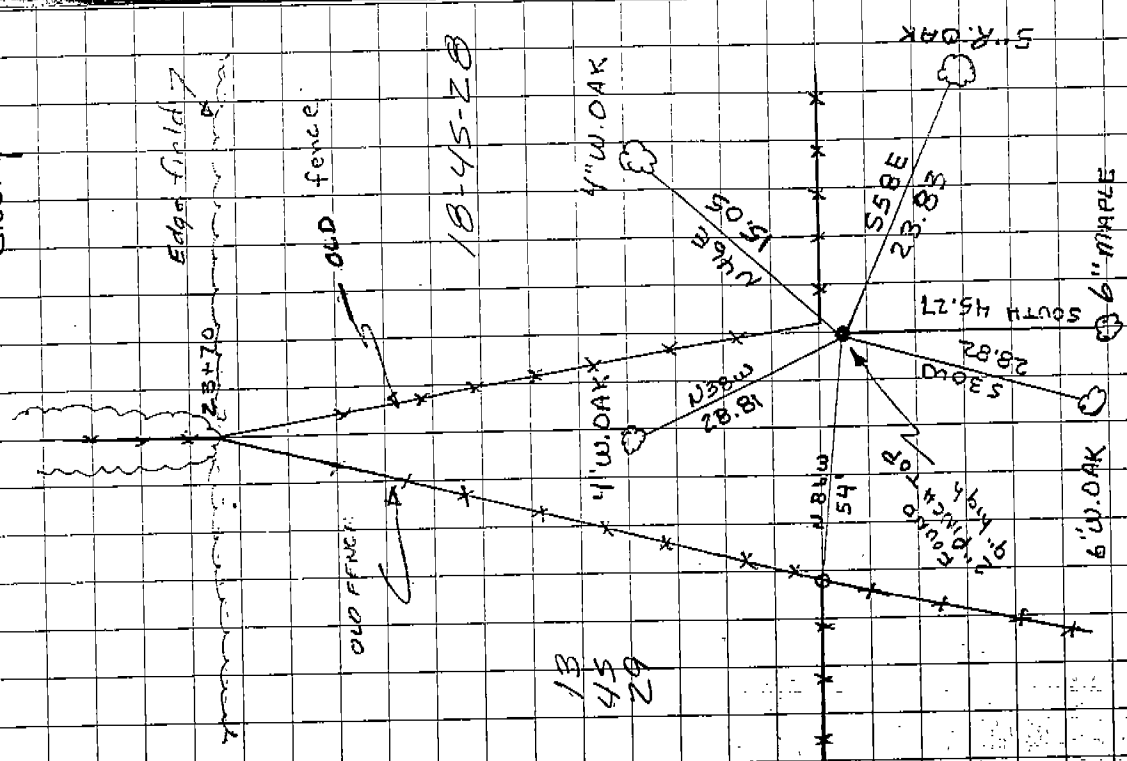

13
45
29

OLD FENCE

OLD FENCE

18-45-28

4\" W. OAK

4\" W. OAK

5\" R. OAK

6\" MAPLE

6\" W. OAK

55 SE
23.83

SOUTH 45.27

28.82

53.82

18.82

28.82

54

18.82

54

18.82

54

18.82

54

18.82

54

18.82

54

18.82

54

18.82

54

18.82

54

18.82

54

18.82

54

18.82

54

18.82

54

18.82

54

18.82

54

18.82

54

18.82

54

18.82

54


1B-8-9
Lover
Homer
cloudy - war

$$I = \frac{3}{4} M C.$$

T45N R228W

FOUND 1 3/4" I.P. ON
SHORE OF LAKE. NO
VISABLE TIES. ORIG.
TIES BOTH BIRCH.
FENCE OCCUPIED TOO
FROM BOTH SIDES.

TIME 1 HR.

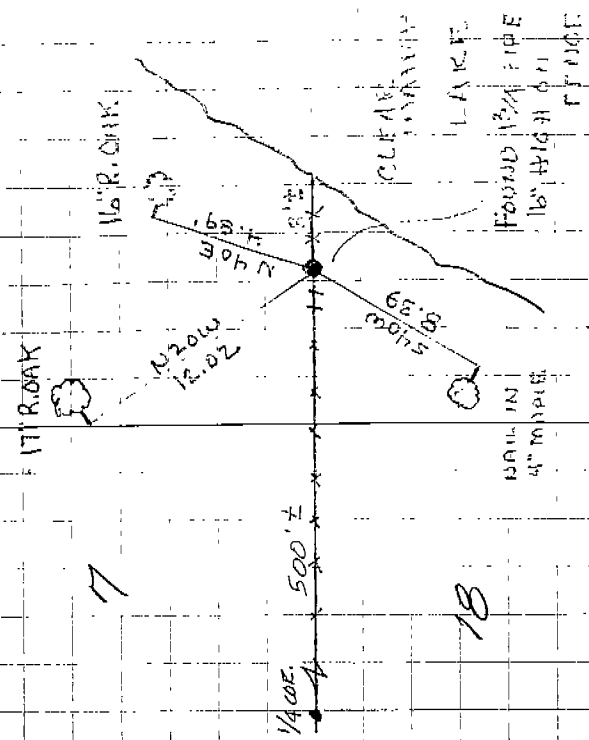

LI-3 1/4 HR. 7/18

TUSN 228W

FOUND LARGE NAIL IN
ROOT OF 12" BASSWOOD.
ONLY ONE VISABLE TIE
LEFT. MADE NEW
TIES AS SHOWN.

Unable to find ties @

WISN

INSERT 11 A
9-8-81

By RHY ANDERSON
as requested by TD.B

TIME 3 1/4 HR.


11A

LT-3 1/4 cor. 7/18
T45N R28W

upon request of Terry Betley
I returned to this corner on
9-8-1981 and find a C.M.C.
cast iron monument under
fence 95 shown.
Also find a 1/2" iron pipe
5.60' west of spike in basswood
tree and metal fence post
on line.

I feel spike in basswood
was not a traverse point as
it would be impossible to
set on with a instrument.
The spike is not in the root
but in a chopped out ledge
on the side of the tree.

7-8-1981

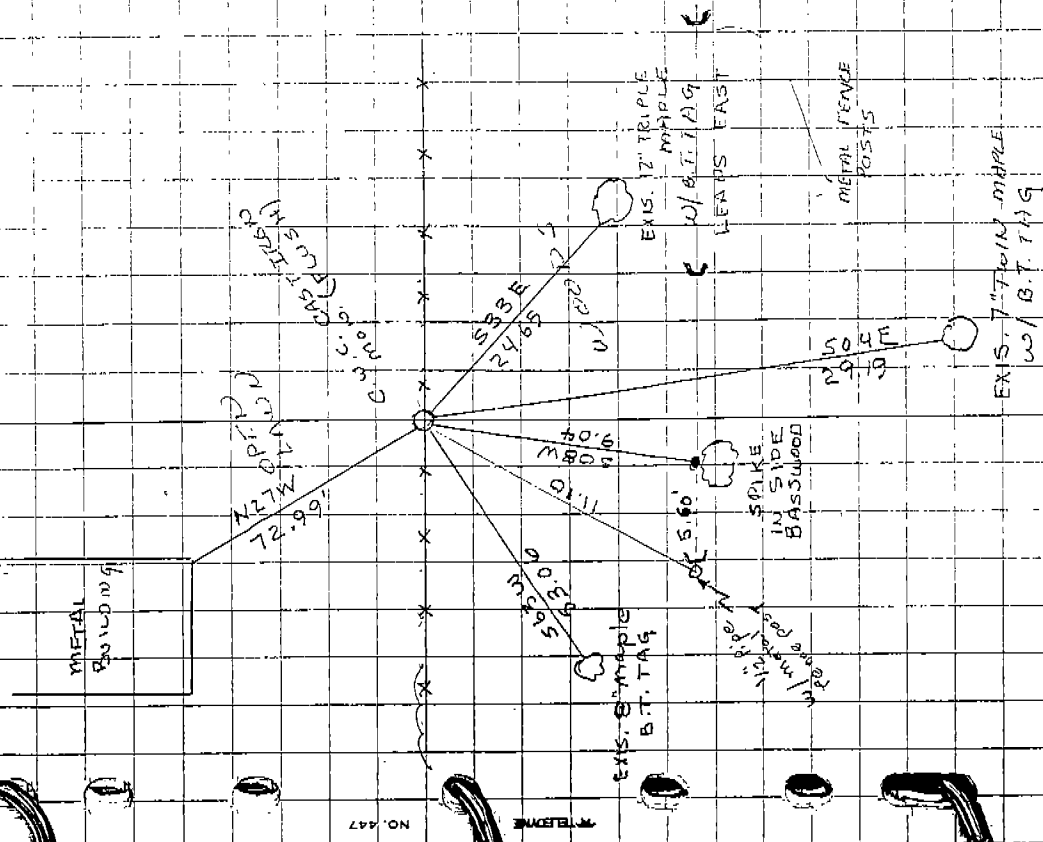RAY 11A
Henner
clear warmLT-3 1/4 cor. 7/18
T45N R28W

No. LC 1-S-107

7-3 1/4 cor.

T45N R28W


U

6-5-31

Ray

Homer

Clear, warm

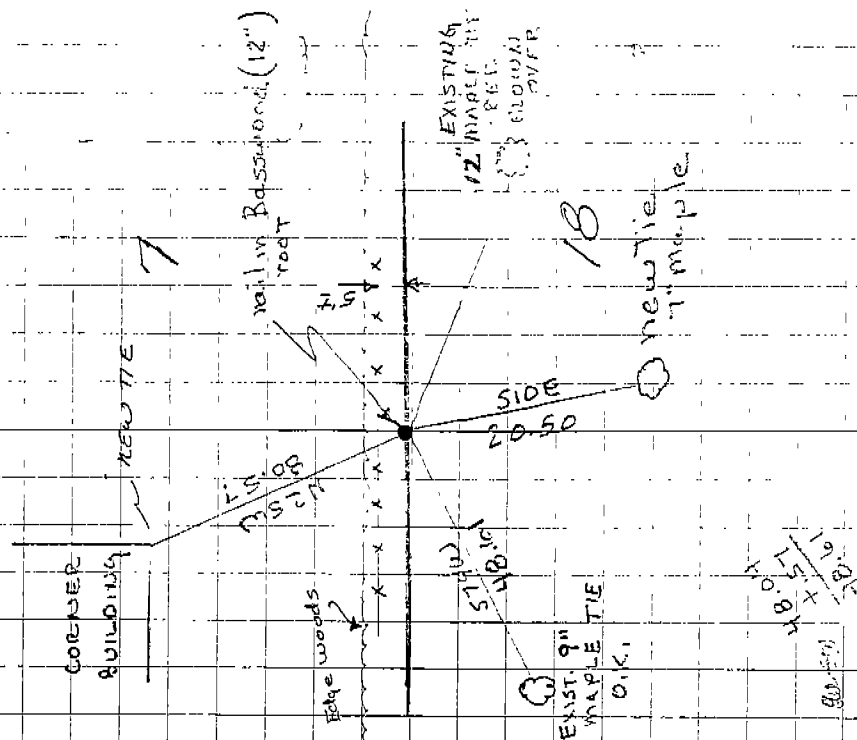

E-1 Sec. Cor.

45-29 12 7 45-28

WALK EAST FROM
THE END OF ROAD ON
NORTH SIDE OF EAGLE
LAKE.

FOUND GROWING
COUNTY CAST IRON
MONUMENT IN PLACE

FOUND ALL 3 THE
TREES AS RECORDED
IN BOOK 135/71.

12" ELM SLOW 9.45
14" N. Pine NOW 140.6
10" ELM EAST 34.3

NORWAY PINE HAS TOP
BLOWN OUT BUT STANDING
IN GOOD ORDER, REOPENED
BLAZES ON ELM TREES.

Time 2 1/2 HRS.

No. S-107

E-1 Sec. Cor.

45-29 12 7 45-28

1-45-29

FOUND BEAVER DAM
ON PINE

6-45-28

ELM
ELM
ELM

12-45-29

7-45-28

DID NOT CHECK DIRECTION
OR DISTANCE TO PINE

12" ELM SLOW 9.45
14" N. Pine NOW 140.6
10" ELM EAST 34.3

6-9-81

Ray
Homer

cloudy - warm

(12)

No. S-107

C-1 1/4 COR. 1-45-29 x 6-45-28

(13)

6-9-81

Ray
Homer

cloudy - warm

C-1 1/4 COR. 1-45-29 x 6-45-28

walk north from east corner (E-1). Impossible to tape on compass line as going thru tornado damage.

Find general location for this corner from quadrangle and swamp. Ties north and south of corner.

Find - NO TRACES OF SIGNS OR A GENERAL N-S LINE, and many pine stumps.

NO CORNER OR ORIG. BEG. TREES FOUND.

Time 4 1/2 HRS.

F/G - 5 M.C.

T45U R28W

(55.8 CH. N. SEC. COR.)

7/8

FOUND 3/4" PIPE IN

PLACE ON SHORE OF

CLEARWATER LAKE

EXISTING THE TREES IN

PLACE - RECORDED IN

BOOK 105/29

BOOK 190/31 WSW. [PIPE 2' N. OF M.C.]

N.W. THE TO PINE DOES

NOT CHECK BY 3' 2

VERY LARGE PINE JUST

NORTH OF CORNER -

HORIZONTAL. MAY BE ORIG.

B.T.

USE CAUTION ON THIS PIPE

MAY HAVE BEEN MOVED BACK

from lake.

TIME 1 1/2 HR.

No. S-107

F/G - 5 M.C.

T45U R28W

7/8

6-10-81 (14)

Ray
Hemmer

Clearwater

EXISTING
8" W PINE

20" W PINE

418W
30.46

35.85
N.T.E.

39.86
S.E.Z.E.

FOUND 3/4" PIPE

7" High in

rocks along

shore

CLEARWATER

LAKE

34.81

4 1.54

35.85

CLEARWATER

POINT

EXISTING
12" ROAK

EXISTING
16" ROAK

EXISTING
16" ROAK

EXISTING
16" ROAK

F - 5/6 M.C. 5/8
T45N R28W

FOUND 3" CAPPED PIPE
ON SHORE OF LAKE.
TIPPED TOWARD LAKE -
(IT MAY HAVE BEEN SET
THIS WAY AS IT SEEMS
VERY SOLID)

ALL THE TREES AS
RECORDED IN BOOK
190/31 (W.S.N.) ARE DOWN
(TORNADO DAMAGE) ORIG. W.P.
STUMP STILL VISIBLE BUT
NO MARKS.

WE MAKE NEW TIES
AS SHOWN.

TIME 2 HRS.

NO. 8-107

F - 5/6 M.C. 5/8
T45N R28W

6-10-81

Ray
Homer
Clear, warm

7" R. OAK

4" R. OAK

NORTH

W. S. N.

5

12" W. OAK

WEST

1.4

CLEARWATER

FOUND 3" CAPPED PIPE

7" HIGH

PIPE TIPPED 530E

TOWARD LAKE

BY 0.22'

E-5 Sec. Cor.
T45N R28W

6	5
7	8

FOUND CEDAR WING COUNTRY
CAST IRON MONUMENT
IN PLACE.

3 OF 4 EXISTING TIE
TREES AS RECORDED
IN BOOK 190/31 (W.S.N.)
STANDING IN GOOD ORDER.
THE DISTANCES DO NOT FIT
GOOD BUT I DO NOT THINK
CORNER HAS BEEN
DISTURBED.


TIME 1 1/2 HR.

No. 8-107

E-5 Sec. Cor.
T45N R28W

6	5
7	8

6-10-81
Ray
Homer
Cedar wing

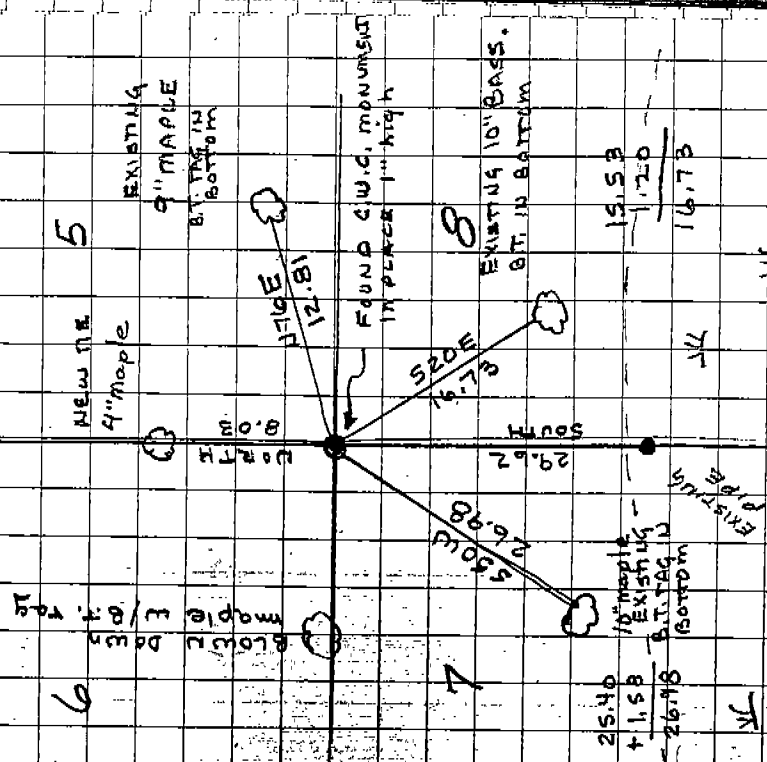

E/F-5

E/F-5

68.25 CH. N. OF SEC. COR.

73.50 CH. N. " "

WE DO NOT LOOK FOR
THESE CORNERS AS
RECORDED PLAT OF
CLEARWATER POINT HAS
SET WEST LINE OF
SECTION 8 FROM NW
CORNER (FOUND) TO
M.C. ON LAKE (E/G-5)
(FOUND)

No. 8-107

6-10-81

Ray

Hammer

Clear, warm

E/F-5

E/F-5

M.C. 3

TUSN 228W

WEST LINE SEC. 8-45-28

E- 7/8 M.C.

} $\frac{5}{8}$

T43N R28W

6-10-81 - Spent 1 hr looking for
this corner from
Quadrangle location and
Brg. WEST ACROSS LAKE
DID NOT FIND BUT FEEL
IT IS IN.

No. S-107

E- 7/8 M.C.

} $\frac{5}{8}$

T43N R28W

6-10-81
Ray
Homer
cloudy-rain

G-1 1/4 COR. 12-45-29 07-45-28

SET 3/4" PIPE ~ 0.30'
deep alongside railroad
TIE gate post FROM
TIES RECORDED IN BOOK
148/47

TIES DO NOT FIT BY 0.5'±
TIE TO OAK AND BASSWOOD
ARE DOWN HILL AND PINE
IS FLAT. HOLD TO PINE
DISTANCE AND AVE. OTHER
2 TIES

ORIG. TIES BIRCH & ASPEN

TALKED W/ BEET JOHNSON ON THIS
CORNER. HE SAID IT WAS PROB. TAKEN
OUT WHEN FENCE WAS PUT IN.

TIME 3 1/2 HRS.

No. S-107

G-1 1/4 COR.

12 45 29
7 45 28

6-11-81

Ray
Homer

clear, warm

EXISTING 14" BASSWOOD
NAIL IN BOTTOM BLAZE
TREE IS DEAD

FACE OF 15' POST
N 15 E 10.51'
FACE OF 15' POST
N 15 E 10.51'
FACE OF 15' POST
N 15 E 10.51'

EXISTING 20" PINE
NAIL IN BOTTOM BLAZE

FIELD ROAD
UT 541

FACE OF 15' POST
N 15 E 10.51'

FACE OF 15' POST
N 15 E 10.51'

EXISTING 20" ROAK
NAIL IN BOTTOM
BLAZE

21.06
19.50
24.21
64.77

No. S-107

C-5 1/4 CR

6/5

T45N R28W

WE CAN FIND NO
PRACTICAL WAY TO GET
TO THIS CORNER AT THIS
TIME. SUGGEST WE
WAIT FOR ICE.

certified by D.V.R. 1-29-86

NO. 325 T.K.

(20)

6-11-81

Ray

Home

Clear, warm

E-24/25 M.C. 12 {
T45N R28W


WE TAPE EAST FROM PIPE
IN CONCRETE AT E-W-S
FENCE CORNER. FIND MANY
PIPE ALONG FENCE LINE.
TALKED W/ MR. SANDHOFF
HE HAD MANY MAPS.
SHOWED US SURVEY MAP
BY L. KNUDSEN (1939) DRAWN
ON BROWN PAPER. KNUDSEN RAN
RANDOM FROM BAY LAKE TO TAMEFISH
AND OFFSET TO TRUE LINE - SET M.C.
@ 2200 ± FROM 1/4 (HE DOES NOT SHOW 1/4)
HE MADE NEW ASH TIES FOR M.C.
MR. SANDHOFF DOES NOT LIKE
FENCE LOCATION - 1/4 COR. LOCATION -
OR M.C. LOCATION ON BAY LAKE!! ?
OUR DISTANCE FALLS SHORT OF
900' ± M.C. AND KNUDSEN LOCATION.
THIS LAKE NOW HAS DAM.

TIME ~ 2 1/2 HRS.

No. S-107

E-24/25 M.C.
T45N R28W

6-11-81
Ray
Hamber
clear, warm

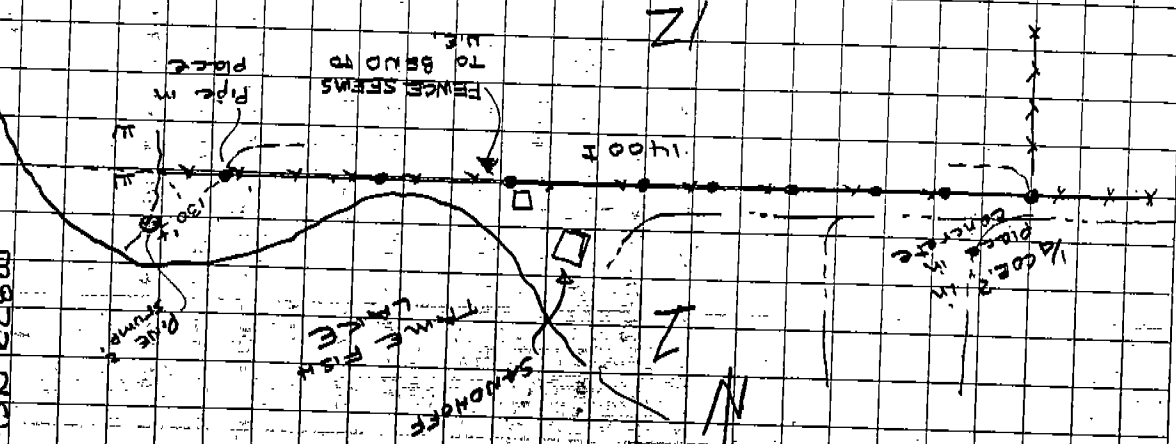

E/F-25

M.C.

12-45-28 7-45-27

WE FIND U-S FENCE RUNNING
TO WATERS EDGE OF TAME
FISH LAKE. NO EVIDENCE OF
CORNER

FIND SOME PINE STUMPS
BUT NO Scribing VISIBLE.

TALKED w/ MR. NELS H.
OLSON. (OWNS WEST 400'
IN RITKIND CTY) HE HAS
NO INFO ON CORNER.
SEEMS TO ACCEPT FENCE.

TIME 2 HRS.

No. S-107

E/F-25 M.C.

12-45-28 7-45-27

(22)

6-11-81

Ray

Homer

cloudy, calm

G-5 1/4 COR. 7.8
T44N R28W

NO. 8-107
G-5 1/4 COR. 7.8
T44N R28W

(23)
6-15-81
Ray
Homer
Clear Water

ORIGINAL TIES BOTH ASSEEN

FOUND 4 MONUMENT OF 5

MONUMENT CORNER: TIE

MON. TO N.E. HAS BEEN

BENT. ALSO 1/4 COR. HAS

been bent over.

THIS CORNER SHOULD

BE RESET FROM S.E.

E S.W. TIE MON.


COUNTER STEVE LINDSTRAM

STAR RT. BRAINERD 764-2940

BEFORE GOING TO THIS CORNER

THEY DO NOT LIKE STRANGERS

TIME 2 HRS.

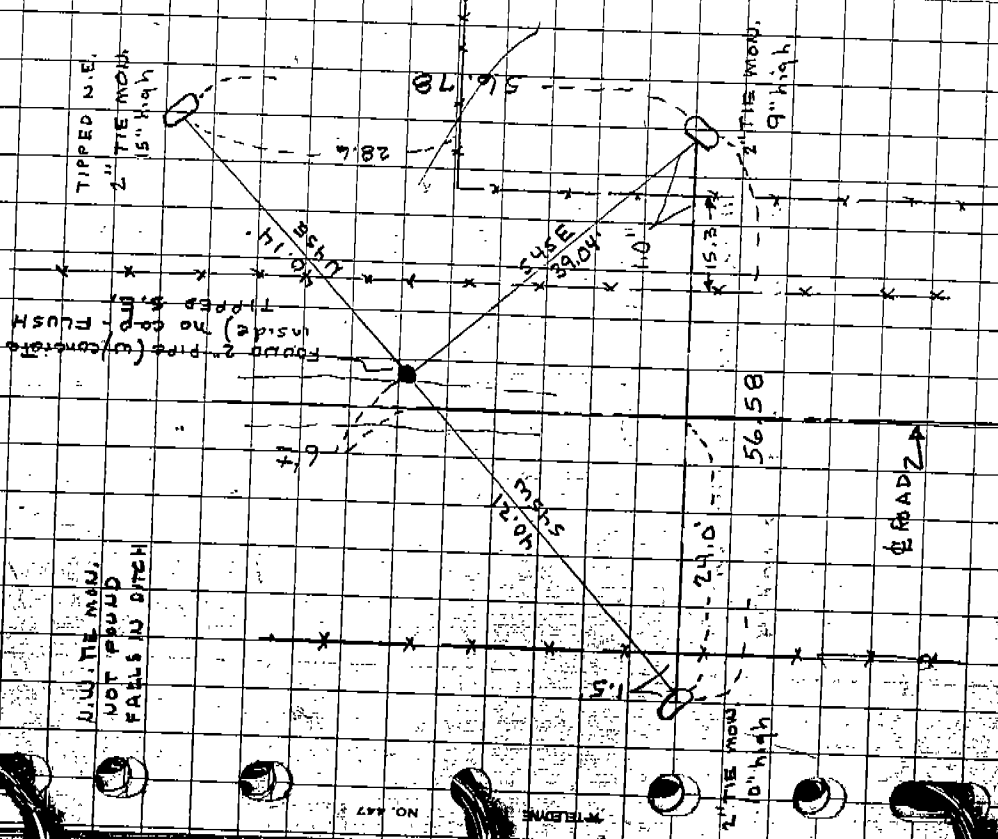

55.59
110.1
15.1

40.2

E-5 Sec. Cor.
T44N R28W

6/5
7/8

TAPE NORTH FROM EAST
CORNER G-5 on E road.

12+57 fence west

13+28 fence east

21+12 Gov't swamp tie -
fits fair.

26+40 fence east

LOOKED FOR ORIG. PINE B.T.

NS9E - DID NOT FIND.

NO CORNER FOUND.

THIS LINE SEEMS TO

BE GOING EAST OR NORTH

AUG. 5 SPENT TIME LOOKING ON
BOTH SIDES OF ROAD, NO
LUCK

TIME 1 HR.

AUG 5 1 HR.

NO. 8-107

E-5 Sec. Cor.

T44N R28W

6/5

7/8

24

6-15-81

Ray

Homer

Clear, warm

C-5 1/4 COR. 615

T44N R28W

WE TAPE NORTH ON E
OF ROAD FROM LAST
CORNER (E-5)

@660' LEAVE SWAMP.

THIS CALL DOES NOT FIT
VERY GOOD BUT EDGE IS
NOT DEFINITE.

@1980 ENTER SWAMP.

THIS CALL FITS O.K.

BOTH TIES ARE TRACK
NOT FOUND.

MANY HOT ROCKS IN
ROAD FILL - DID NOT
ATTEMPT TO DIG THEM
ALL.

NO CORNER FOUND.

Tape 2 HRS.

No. S-107

C-5 1/4 COR. 615

T44N R28W

125

6-15-81

Ray

Homer

Clear, warm


J-3 1/4 COR. 7/18
T44N R28W

NO ORIGINAL TIES FOR
THIS CORNER COULD
NOT FIND.

TALKED TO A MR.
COOLEY - OWNER TO
N.W. OF THIS CORNER.
HE HAS BEEN ON HIS
PLACE FOR 30 YEARS.
HAS NEVER SEEN A
CORNER AT THIS LOCATION.
FENCE TO NORTH IS HIS
EAST LINE AND IS
ACCEPTED AS LINE.

TIME 3 HRS.

No. S-107
J-3 1/4 COR. 7/18
T44N R28W

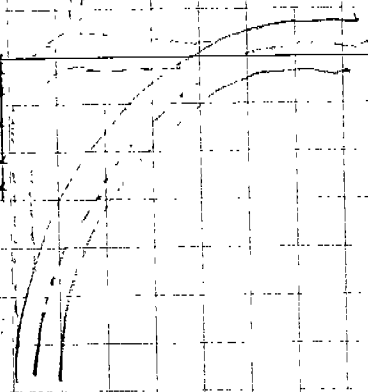

NO. 447

WEST EDGE

(26)
6-25-81
2nd
Homer
Clear, warm

E-3 1/4 COR. $\frac{6}{7}$

T44N E28W

WE TAPE EAST FROM
CORNER E-1 (S.W. COR.
SEC. 6) 46 CHAINS -
3036' - FIT SWAMP
TIES FAIR, CROSSED
FINGERS OF HIGH
GROUND COMING INTO
SWAMP FROM SOUTH BUT
NOT NOTED IN ORIG. NOTES.
VERY DIFFICULT TO TARE
AND RUN COMPASS LINE.

FOUND OLD BRUSH LINE
(E-W) coming in FROM
WEST. IT IS ABOUT
100' SOUTH OF OUR
LOCATION. -
NOTHING FOUND.

TIME 5 HRS.

No. S-107

E-3 1/4 COR. $\frac{6}{7}$

T44N E28W

R ON 1-8-82 T. B. 57461 42014 WITH SURVEY

CREW WORKING U.S.A. MEASURED 111 20402

ALONG A BRUSH LINE FROM CORNER

AND SOUTHERLY CORNER 111

MEASURED 111 20402 111 20402

ALONG BRUSH BRUSHED LINE ONLY

EVIDENCE BRUSH WAS A BRUSH

WITH A BRUSH LINE 111 20402

LINE 111 20402 111 20402

THESE TIES TO THE BRUSH LINE

WAS THE BRUSH LINE 111 20402

WAS THE BRUSH LINE 111 20402

WAS THE BRUSH LINE 111 20402

WAS THE BRUSH LINE 111 20402

WHAT IS THE LINE 111 20402

NO. 447

TELEPHONE

(27)

7-1-81

Ray

Home

Clear - Not

E-9 SEC. COR.
T44N R28W

5/4
8/9

FOUND ALL MONUMENT IN
PLACE FROM J. CURE
R22 S MON. CORNER
(Pg 149, CWC BK A)
SECTION CORNER MIN.
WAS 0.05' ABOVE ROAD
GRADE AND HAD BEEN
TIPPED BADLY N.E. - WE
TRIED TO REMOVE CORNER
TO SET CWC MON. BUT FAILED
DUE TO LARGE ROCKS. (FOUND
LARGE WALL W/ RIBBON AT TRUE
LOCATION) DROVE PIPE
DOWN AND BENT BACK
TO POSITION EST. FROM
N.E. E.S.E. THE MONUMENTS.
PIPE NOW 4" DEEP.

TIME. 3 HRS.

NO. S-107

E-9 SEC. COR.

T44N R28W

5/4
8/9


(28)

7-1-81

Ray

Hoover

Clear-Hot

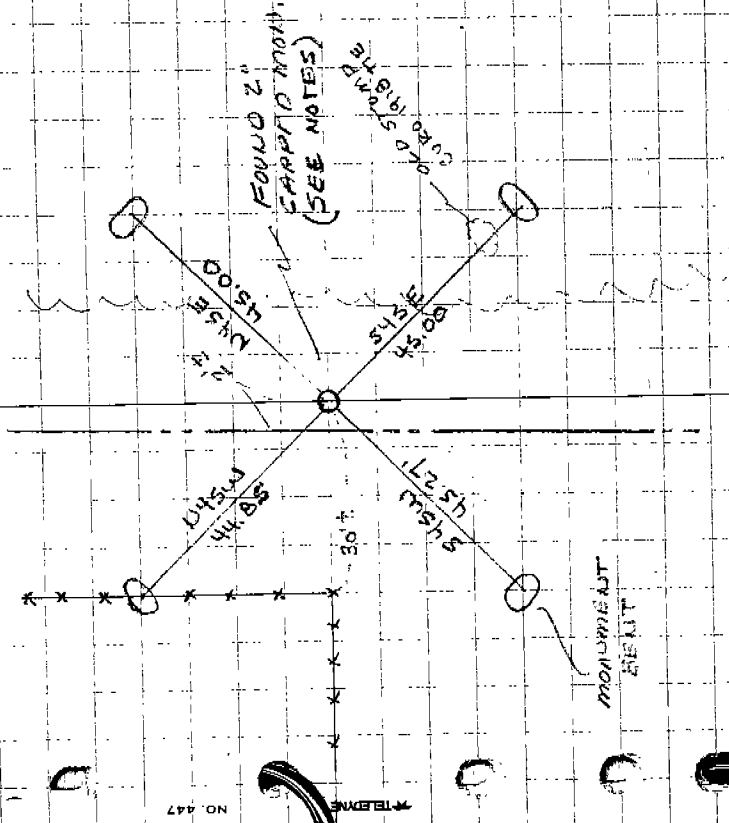

No. S-107

C/D-17 M.C.
T44N-R28W

3

2

7-23-81

Ray

Wetnet

cloudy, 40-100

(30)

7-23-81

C/D-17 M.C. T44N R28W

3

2

Looked for white rarer
on 7-23-81. Found two
fences going south
from lake - unable to
tell which one on sec.
line. - will get more
info -

Time 1 hr.

NO. 447

WETNET

4/9

E-1011 M.C.
T-44N R28W

FOUND 1 1/2" PIPE 3" HIGH
ON SHORE

NO EVIDENCE OF ORIG.
BEARING, THERE

THIS PIPE POSS. SET BY
LOT OWNER TO MARK

TIME 1 1/2 HR.

No. S-104

E-1011 M.C.

(5920 CH. 11, SEC. 24)

T-44N R28W

Pay

Home

Cloudy - Clear

4-44-28

18" Red Oak

NO. 447

WELBYNE

MILLER
LAKE


Pipe Tapped

EAST 2 1/2"

DIST. TO CENTER
OF TOP

1 1/2" Pipe 3" high

9-44-28

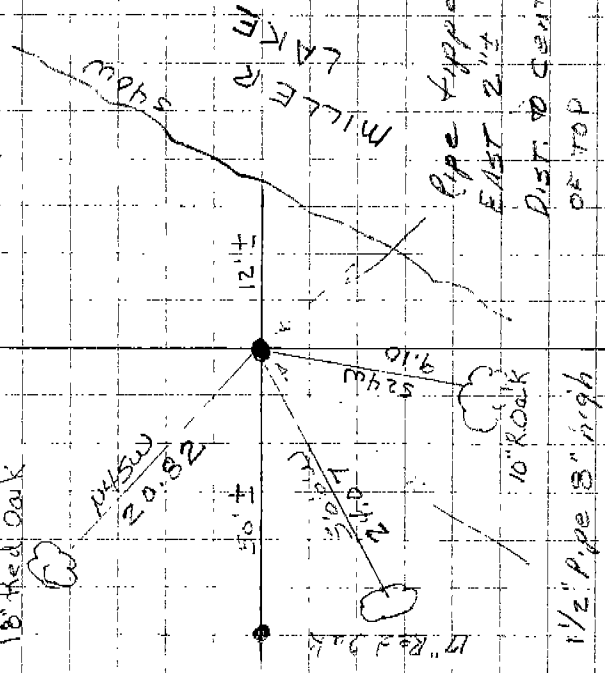

G-9 1/4 COR. 8/9

T44N R28W

(CAP GONE)

FOUND 2" I.P. IN ROAD

4" DEEP & 3 TIE

MONUMENTS

N.W. TIE GONE.

TIED OUT AS SHOWN

LOOKED FOR ORIG. W. PINE

8" T. NIGLE - NOT FOUND

TIME 1 1/2 HRS.

No. S-107

G-9 1/4 COR. 8/9

T44N R28W



32

7-23-81

BAC

LOUISIANA

LOUDON, W. VIRG.

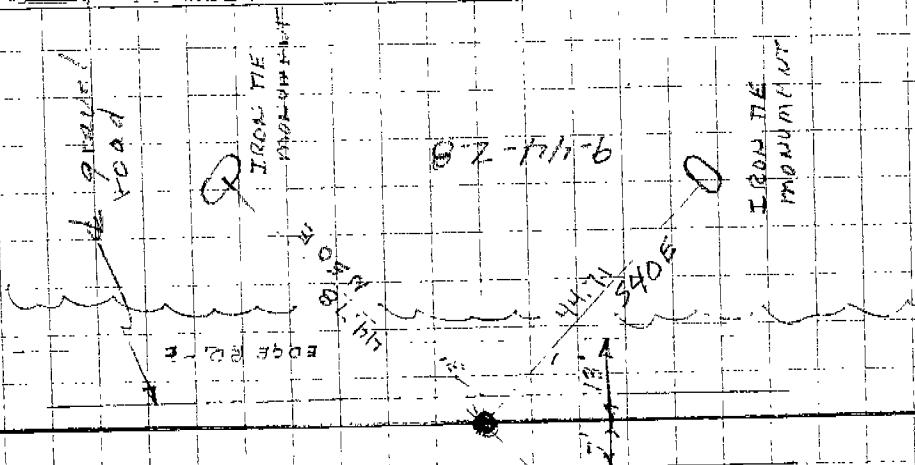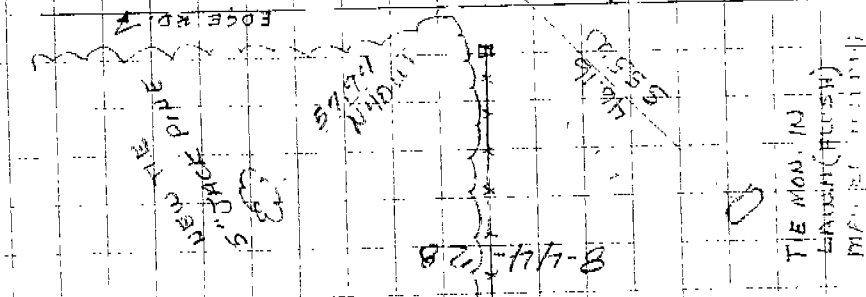

E-11 1/4 COR. 4/9
T440 R28W

FOUND EXIS. C.W.C.
CAST IRON MONUMENT
IN PLACE AND EXIS.
TIE TIES AS SHOWN
WEN 296/31

E-10/11 (40.80 CH. W.)
NOT FOUND - NO EVIDENCE

TIME 1 1/2 HR.

No. S-107

E-11 1/4 COR. 4/9
T440 R28W

7-23-31 (35)

4-44-28

4-44-28

EXIS. 15" RED JAC. DBL BLAZE
B.T. 109.10 BOTTOM

EXIS. 12" ELIM
DBL. BLAZE
B.T. Bottom

6' Deep

70.82
170W

182+

100-53

BOARD FENCE

NO. 447

TELEPHONE

45.12
100-53

100-53
100-53

EDGE RD

G-13 1/4 COR 9/10
T44N R28W

C.W.C. CHST FROM M.M.N.
WE FIND THIS CORNER
TO BE FLUSH W/ GRAVEL
SURFACE ROAD -
LOWER TO 6" BELOW
GRADE.

TIES: WSN 296/29

TIME 1/2 HR.

No. S-107
G-13 1/4 COR
T44N R28W

7-23-81 134
Ray
Homer
cloudy, warm

E-7 1/4 COR. $\frac{5}{8}$

T44N R28W

Found 2" I.P. 8"

High W/ BARR WIRE TIED

ON IT. SHORT RAKE

WIRE LAYING TOWARD

CORNER POST. PIPE IS

VERTICAL.

WE TAPED WEST FROM

E-9 ALONG FENCE IN

FAIR CONDTION 1314±

FOUND FENCE TO NORTH

FENCE VERY CROOKED

USING TREES AND POSTS,

ONLY A ST 40 - ORIG. SWAMP

TIES DO NOT MAKE SENCE.

THIS PIPE MAY HAVE BEEN

SET FOR THE DOWN FOR

CORNER POST?

UNABLE TO FIND LAND-OWNER

AT HOME.

TIME $3\frac{1}{2}$ HRS.

No. S-107

E-7 1/4 COR. $\frac{5}{8}$

T44N R28W

8" W OAK

8" W OAK

N 80 W

45.41

S 45 E
27.52

N 76 E
12.48

272.41

34.25
77.17

7" ELM

6" ELM

(35)

7-27-81

Ray

Home

cloudy, dawn

BOON

W. 20 E

4.20

NO. 447

W. 20 E

N-5 SEC. COR. 18/17
19/20
T44N R28W


WE TAPE EAST FROM d
COUNTRY ROAD 8 ALONG
FIELD ROAD. ENTER
WOODS AND TAPE AND
COMPASS ALONG E-W
FENCE (DOWN) TO
INT. OF N-S FENCE.
FIND 5 MON. CORNER
AS SHOWN.

DID NOT LOOK FOR ORIG.
B.T.S.

TIME 3 HRS

No. S-107
N-5 SEC. COR. 18/17
19/20
T44N R28W

7-27-81 36
Ray
Hammer
Cloudy, warm

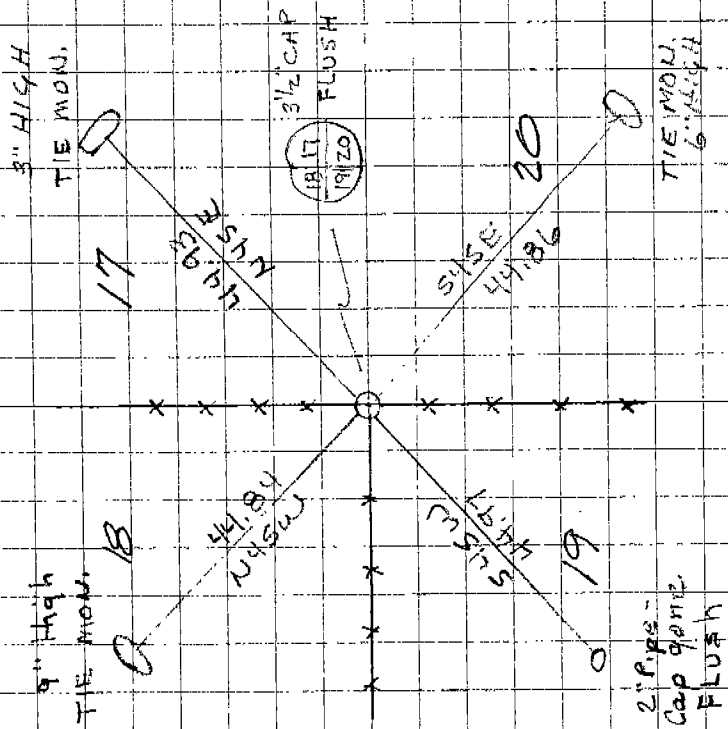

P-5 1/4 COR. 19/20
T44N R28W

FOUND 5 MON. CORNER
IN PLACE AS SHOWN


DID NOT LOOK FOR ORIG.
BRG TREE

TIME 2 HRS.

No. 3-107
P-5 1/4 COR. 19/20
T44N R28W

7-29-81 Ray
(37)

Former
Preboudy, coal

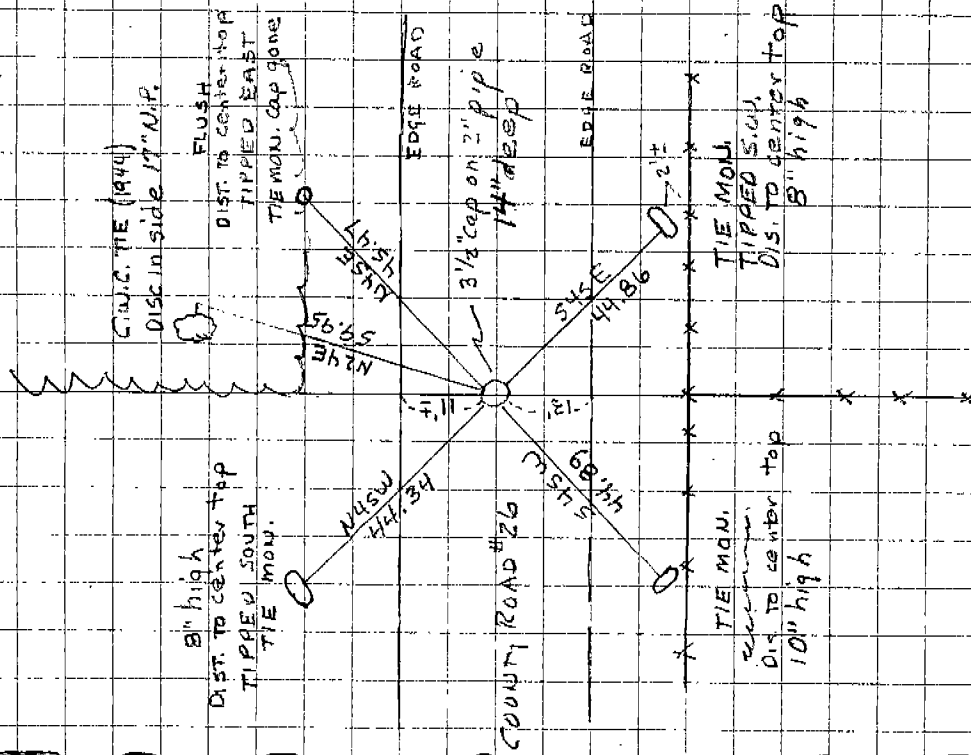

N-7 1/4 COR. 17
20
T44N R28W

WE TAPE AND COMPASS EAST

FROM N-5 2640 FT

FOUND 5 10' ON. CORNER IN
PLACE AS SHOWN

DID NOT FIND ORIG.

B.T. OR 1917 TIES OF

L. KNV050N - BOOK 13/29 (WSN)

TIES 4 1/2 HRS

No. S-107

17
20

N-7 1/4 COR

T44N R28W

38

7-29-81

Ray

Homer

Pt. cloudy, warm

X OLD E-W FENCE (OPWU)

4" HIGH
TIE MON.

9" HIGH
TIE MON.

17

7.53

N45W
44.96

NO. 447

N45E
44.96

3 1/2" CAP ON 2" PIPE
12" HIGH
STAMPED

W TIE LINE

S45W
46.71

S45E
44.93

20

TIE MON.
8" HIGH

TIE MON.
9" HIGH

19/30

R-3 1/4 COR.

T744N R28W

FOUND 1 1/4" SOLID ROD
w/ POINT ~ 1.2' LONG ~ 6"

BELOW GROUND ON EDGE OF
PAVEMENT, TIPPED AT 45°
TO SOUTH - STRAIGHTENED BY
MOVING TOP NORTH 0.53'
TIED OUT IN THIS VERTICAL
POSITION.

ORIGINAL TIES 54 1/2"
30.5 LK. FALLS IN POND
518 1/2 W 254 LK. FALLS IN ROAD
WATER MUST BE MUCH
HIGHER THAN WHEN ORIG.
SURVEY.

THIS CORNER WOULD NOT
BE A SPLIT BETWEEN
R-1 & R-5 AS INDICATED ON
C.W.C. LAND CORNER RECORD.
WSN 6/82

TIME 1 1/2 HR

No. S-107

R-3 1/4 COR. 19/30

T744N R28W

19

30

(39)

7-29-81

804

WOM #12

CLOUDY, WINDY

8" W. OAK

16" R. OAK

9" W. OAK

POND

57.52

183E

534E

62.85

11.4

FENCE IN

HEDGE ROW

ORANGE HILL

COUNTY ROAD 8
EDGE AT
EDGE AT

NO. 447

W. TIDE LINE

L-5 1/4 COR. 10/17

T44N R28W

TAPE AND COMPASS

EAST FROM CORNER 1"

FIELD (NE CORNER OF

NW 1/4 SE 1/4) 1320' along

old fence line, mostly
down, FIND INT. OF

N-S-W FENCE, NO

CORNER OR EVIDENCE

FOUND.

TIME 3 1/2 HRS.

No. S-107

L-5 1/4 COR. 10/17

T44N R28W

7-30-81

Ray

Stamer

cloudy, warm

40

J-5 SEC. COR. 7/8
18/17

T44N R28W

WE TAPE AND COMPASS
NORTH FROM FENCE
CORNER @ L-5. FIND OLD
FLAG LINE AND FOLLOW
TO SE, THE MONUMENT.
FIND ALL THE MON. AS
SHOWN.

FIND 1/2" X 10" SOLID ROD
IN HORIZ. POSITION AT
CENTER.

NOT HAVING INSTRUMENT
WE RE-SET 1/2" X 10" ROD AT
POINT SHOWN - SPLIT USE
SW and SPLIT NW & SE
DID NOT FIND ORIG. PAVE
BT @ SSE 260 CK. DID NOT
LOOK FOR OTHERS.

TIME 4 1/2 HRS.

No. S-107

7/8

J-5 SEC. COR. 18/17

T44N R28W

7-30-81

Ray

Warmer

Cloudy, warm

FLUSH
TIE MON.

7

FLUSH
TIE MON.

LARGE NIPPLE
TIE MON. TIGHT
AGAINST SE.
SIDE

8

N45W
39.85

N45W
41.04

1/2" X 10"
SET ROD

N45W
39.85

S45E
39.85

18

N45W
41.04

17

TIE MON.
6" HIGH ±

TIE MON.
12" HIGH ±

OLD FENCE LINE
SOUTH

NO. 447

W7B EDVNE

(41)