


Crow Wing County Surveyor,
No. S-114




Crow Wing Co.

1981

Remonumentation

Contract 5-114

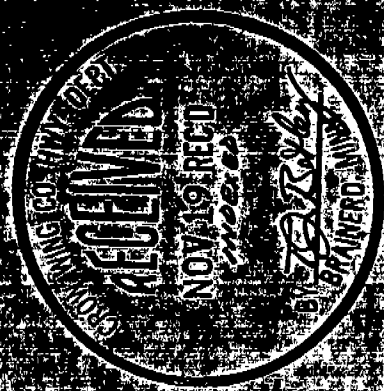

Index Twp 47N, R9c 28W.

Page		
1	R-17	NE cor sec 27
2	R-13	NE cor sec 28
3	R-21	NE cor sec 26
4	P-21	East 1/4 cor sec 23
5	U-21	NE cor sec 23
6	T-21	East 1/4 cor sec 26
7	V-21	NE cor sec 35
8	X-21	East 1/4 cor sec 35
9	L-21	East 1/4 cor sec 14
10	T-21	NE cor sec 14
11	E-21	NE cor sec 11
12	D-C 21	Mc common To sec's 1 & 2
13	F-21	1/6 cor NW cor SW/4 sec 12
14	E-19	North 1/4 cor sec 11
15	E-17	NE cor sec 10
15	D-B 17	Mc common To sec's 2 & 3
15	E 16 & 17	Mc common To sec's 3 & 10
16	G-21	West 1/4 cor sec 12
17	J-25	SE cor sec 12
18	L-25	East 1/4 cor sec 13
19	U-25	SE cor sec 13
20	P-25	East 1/4 cor sec 24
21	X-17	East 1/4 cor sec 84
22	V-13	NE cor sec 33

Twp 47N, Rgc 28W

Cont.

Index

Page	Index	Cont.
47	J-13	SW COR SEC 10
48	G-17	EAST 1/4 COR SEC 10
49	H-13	MC on East line sec 9 on shore Miss R.
50	J-14	MC on SO line sec 9 on East shore Miss R.
51	J-15	SO 1/4 COR SEC 10
52	P-13	EAST 1/4 COR SEC 21
53		
54	E-23	SO 1/4 COR SEC 1
55	E-25	S.E. COR SEC 1

NO. 247

Index Twp 47N, Rgc 29W

Index

Page	Index	Cont.
56	L-13	EAST 1/4 COR SEC 16
57	K-L-13	MC on East line sec 16 on shore Miss R.
58	N-14	MC on North line sec 20 on East shore Miss R.
59		
60	Z-9	SW COR SEC 33
61	Z-11	SO 1/4 COR SEC 33
62	Z-13	SE COR SEC 33
63	Z-7	SO 1/4 COR SEC 32
64	Z-5	SW COR SEC 32
65	Z-3	SO 1/4 COR SEC 31
66	X-13	EAST 1/4 COR SEC 33
67	V-13	S.E. COR SEC 28


FIELD NO.

①
OCT 13, 1981
TERRY SAVALOJA
TOM GARLINGHOUSE

R-17
CORNWALL COMMONS TO
22-23-24-27
SECTIONS
T47N R28W

R-17
Post Set in 1870
Fd in place in 1893 by Whiteley
1922 5" cures set 3/4" x 10" iron for
Tamp corner.
1946 County Highway dept Fd marker
in place three ties were:
12" oak NW 1/3 35
6" Oak of Cilled NE. 41/60
No ties found searched
for corner for 1/2 hour
County Road 30 has been
reconstructed in the last few
years and so the corner might
have been lost at that time

Time Spent 1 hour

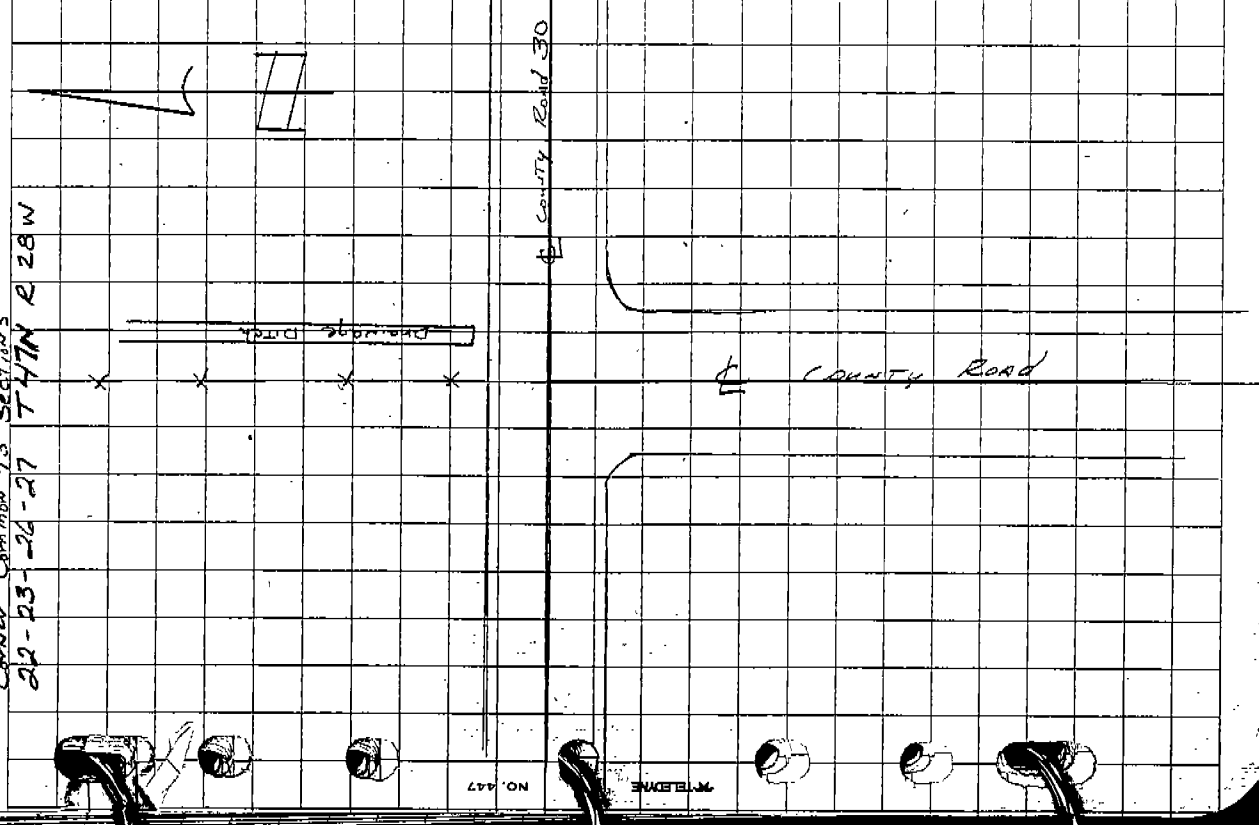

OCT 13, 1981
Tom Gering House
Terry SAVALOTA

R-13

County Courthouse To

Sections 21-22-27-28 T47N R28W

R-13

1870 POST SET BEETLES

1887 WHITKEY Fd monument in place

And He ALSO Fd the monument in place

IN 1900

1921 J. C. CUBO SET 34" x 10" IRON PIN

2 1/2" Black N35E 50E

14" white pine N37W 94 1/2 FT

5" post 54 1/2 N 53 1/2 E

6" post 54 1/2 E 37 1/2 PT

Searched for 1/2 hour

Found nothing

County Road 30 has been rebuilt

in the past few years. This

Might be the reason we were unable

to locate any evidence of the

corner

TIME SPENT 1 hour

Old
Driveway

4 Township Road

to County Road 30

NO. 447

TELEPHONE

P-21

1870 POST SET

1890 RK WHITELEY SET MONUMENT AT INTERSECTION

1921 J. C. C. SET 34" X 10"

1969 County Highway, DEPT. OF HIGHWAYS
IN PLACE 16" JACK PINE N134°E

16" POPLAR S75°E 125°E

1981 Fd 34" IRON PIN AT SURFACE
OF TRAIL

TIES:

BRASS 709 IN PLACE SET 99°
NAIL IN SIDE 15" IR N50W 82°E

NAIL IN POWER POLE N35W 89°

NAIL IN 6" JACK PINE S50W 124°E
NAIL IN 14" POPLAR S75°E 125°E

THIS COUNTY ROAD 32 HAS
BEEN REBUILT IN THE LAST FEW
YEARS

TIME SPENT 1 1/2 HOURS


8

P-21

1/4 CORNER CORRESPOND TO SECTION 23 E 24

TWP 47 R 28 W

OCT 13, 1981
TOM GARDINGHOUSE
TERRY SAKALINJA



Road 32

DEPT. OF HIGHWAYS

15" IRON PIN

34" IRON PIN

34" IRON PIN

34" IRON PIN

34" IRON PIN

34" IRON PIN

34" IRON PIN

34" IRON PIN

34" IRON PIN

34" IRON PIN

34" IRON PIN

34" IRON PIN

34" IRON PIN

34" IRON PIN

34" IRON PIN

34" IRON PIN

34" IRON PIN

34" IRON PIN

34" IRON PIN

34" IRON PIN

34" IRON PIN

N-21

CONVEY COMBINED TO SECTIONS 13-14-23-24

T-47 N E 28 W

1870 SET POST

1890 RK WILKLEY Fd post in place

1921 John Curo SET 3 1/4 x 10" IRON

MINI-MOUNT. SET TIES

1935 County Highway dept Fd 3 1/4 x 10" IRON

1969 County Highway dept Fd 3 1/4" IRON PIN

SET TIES

1981 Fd 3 1/4" solid IRON PIN in E TIE

AND A old Road going EAST

FLUSH WITH SURFACE OF TAR.

N 10° N 10" POPLAR N 75° W 104 1/2

N 10° IN 8" POPLAR S 30° E 108 1/2

N 10° IN 12" POPLAR N 60° E 111 1/2

COUNTY ROAD 32 IN THIS AREA

HAS BEEN WIDENED IN THIS AREA SO

THE TREES HAVE BEEN CLEARED FROM

THE ROW. QUITE SOME DISTANCE BACK

FROM E

Time Spent / hour

OCT 13, 1981
Tom Garlinghouse
TERRY SAVALLOTTA

N-21

COUNTY ROAD 32

NO. 447

N 10° N 10" POPLAR

Fd 3 1/4" solid IRON PIN
FLUSH WITH SURFACE OF TAR.

N 75° W 104 1/2


old Road

S 30° E 108 1/2

N 60° E 111 1/2

N 10° N 10" POPLAR

5



12

1870

Post Sec

Set Whipping Set post on M. 11. 11. 11.

1913

1971	7 Cur 2	2	811' Trench
------	---------	---	-------------

1922 J. Cuklo set 341 "14" "1000000"

1969	Line of contact well	3-1	1000
------	----------------------	-----	------

1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75	76	77	78	79	80	81	82	83	84	85	86	87	88	89	90	91	92	93	94	95	96	97	98	99	100
---	---	---	---	---	---	---	---	---	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	-----

Topic: History Date: 25-11-2022

5-20-00	130 ²
---------	------------------

1981	Feb 10	Spk. Flash w/ 1st
------	--------	-------------------

052 T4th Road 115.1 mi to the Pond

East Edge of Concrete Culvert	27	96	East
-------------------------------	----	----	------

Na. C	INDRE CONE POST WEST	1406
-------	----------------------	------

Ag. N. Davis pole SSE 16672

Time Spent: 12:30


OCT 13, 1981

Tom Garlinghouse.
Ferry, Suva LOMA

1-21

Q

1/4 cor common T₁ Sec 25-26-T47N R33W

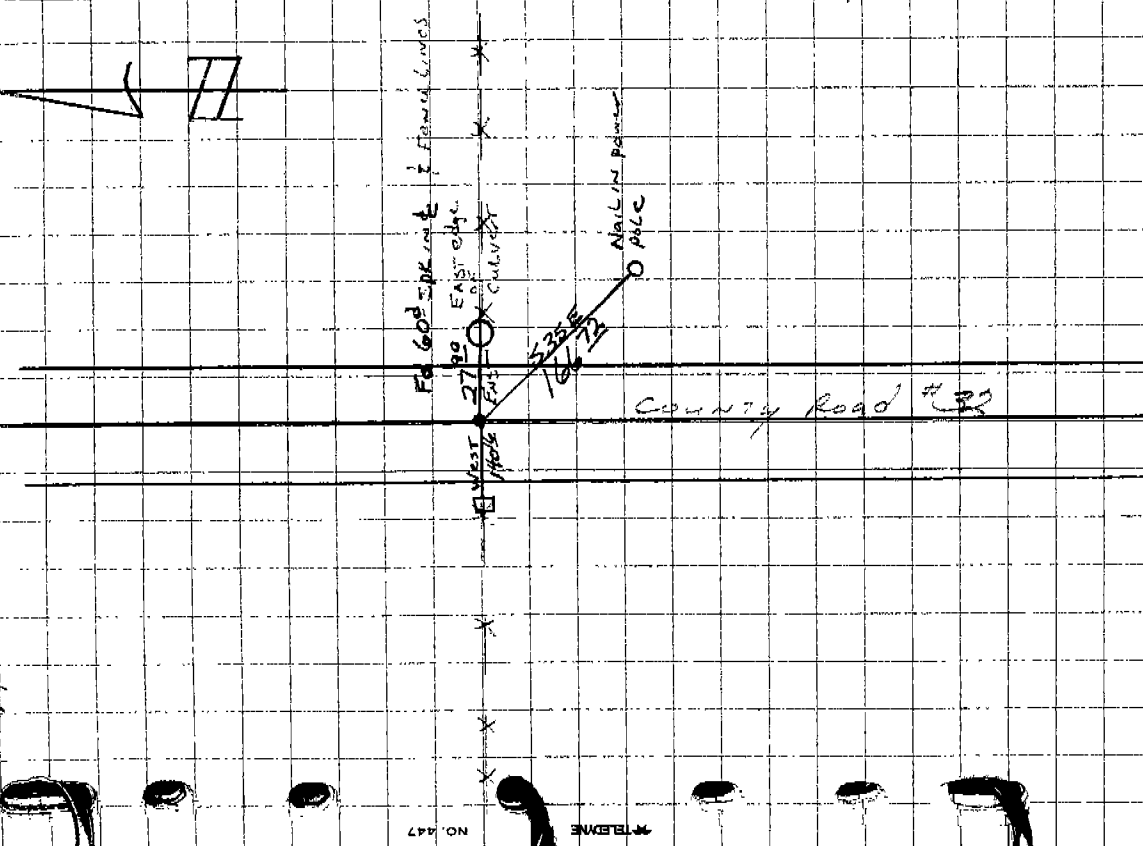

OCTOBER 13, 1981
Tom Garlinghouse
Terry Savalaja

⑦

V-21

SECTION CORNER CONTINUED TO

SECTION 26 - 26 - 35-36 Twp 47 R 28

1870 A POST WAS SET

1890 RK WHITELEY Fd post in place

1894 RK WHITELEY Fd post in place

1904 L.E. GARRISON " FOUND STONE MARKER

1913 KNUDSEN FOUND MARKER IN PLACE

1921 J CURRY SET 3/4" x 10"

1946 County Highway Dept FOUND

STONE IN PLACE

1969 Highway Dept Fd 5PK in place

4" WHITE OAK 570 W 125² W

power pole N 100' 1922

2' x 2' ROCK 545 E 138²

1981 Fd 3/4" solid pin in place

NAIL IN Telephone pedestal 570 W 84⁸³

NAIL IN Telephone pedestal N 65 W 83⁸³

NAIL IN power pole N 60 E 61⁸⁵

Fence Gang East 15' of line

with 3/4" solid pin in place

Time spent 1 hour

NO. 447

Telephone pedestal

FD 3/4" solid pin in place

85 - NAIL IN power pole

85 - NAIL IN power pole

85 - NAIL IN power pole

85 - NAIL IN power pole

85 - NAIL IN power pole

85 - NAIL IN power pole

85 - NAIL IN power pole

85 - NAIL IN power pole

85 - NAIL IN power pole

85 - NAIL IN power pole

85 - NAIL IN power pole

85 - NAIL IN power pole

85 - NAIL IN power pole

85 - NAIL IN power pole

85 - NAIL IN power pole

85 - NAIL IN power pole

85 - NAIL IN power pole

85 - NAIL IN power pole

L-21 Quarter corner common to
sections 13 & 14 - T47N R28W


1870 POST SET FOR CORNER
1890 RK WHITELEY SET POST IN
PLACE
1921 J. CURR SET 3/4 X 10" IRON
1935 County Highway Dept. Ed
MANAGEMENT IN PLACE
1969 County Highway Dept. RUMMAN
SPK IN PLACE - SEC 7 Ties

Nail in 12" poplar N75W 170°
1 1/2" pipe in place N45E 100°
No pipe found S.E. AS Highway Dept
Ties said.

Found Large spk in place
Flush with surface of TAR

Time spent 1 hour

OCT 13, 1981
Tom Garlinghouse
L-21 Terry Savala

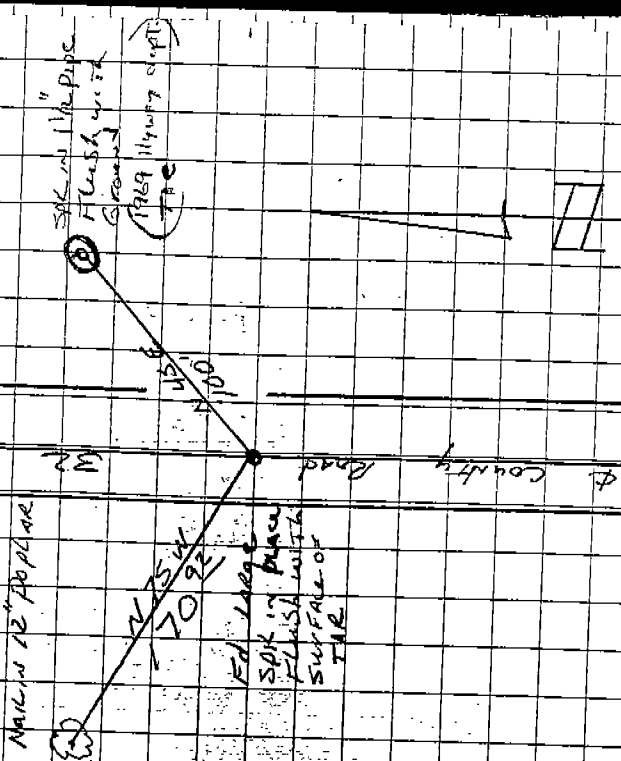

Cor Common To 11-12-13 & 14 Twp 47, Rge 28

J-21

found Cast Iron Mon 11' below
surface of Road, in line with
d Road south & East

Prior Records of Cor.

In 1921 J. Curo set 3/4" x 10" Iron
Mon. for Temporary Cor. He also
indicated 1" x 10" Irons N 45° W and so
45° W 45'. These Tie Monuments were
Apparently Taken out by the ditching
to the West.

1870 orig Govt Post No Ties

1891 R.K. Whiteley calls for post Range 3 BK W-8

1935 Co. Map Rept file 32 R/W Map 428

Time spent 3/4 hrs

Oct 16, 1981
W. Buckler
Rick Marsh

J-21

drainage ditch

4" Iron Rd

End of Bit Surface

No Trees near for Bit's

5 edge Bit

5th projected west

QCH 322

Set 1/2" Iron pipe w/cap
marked 9612 on Edge
of Bit

Set 1/2" Iron pipe w/cap
marked 9612 on Edge
of Bit

6th projected north

QCH 322

Core Comen To 1-2-11-12 Twp 47, Rgc 28
E-21

Searched Area with locator
and nothing found. The Area
Appears To Have been cleared
with a dozer so no excavations
were made in the search.

I Talked To Mrs Rinta who lives
on the NW 1/4 of sec 12 and
owns the SW 1/4 - SW 1/4 of sec 1
and she said they had no
knowledge of any corncries.

Prior Records of Core.


- 1870 orig post
- 1890 R.K. Whitney calls for orig post
in place. (page 3 BK W-8)
- 1921 J. Curo calls for 12" stone with +
in place. (page 571 CW. 90 BK A)

Time spent 1 hr.

OCT 16, 1981
W. Buckler
R. Marsh.

11

E-21

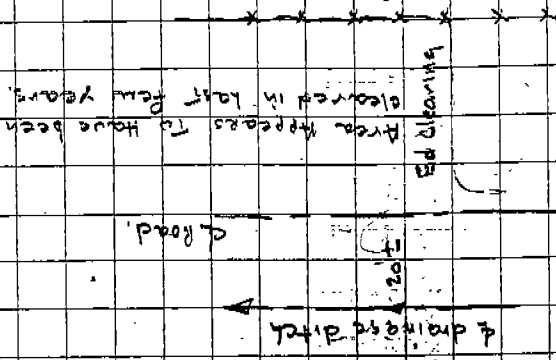

7

C-D 21 M.C. between sec's 1 & 2 Twp H7, Rge 28
on South Shore of Miss. R.

searched entire Area from crest
of Bank down to shore of River.
The remains of old fence as shown
on sketch was down in the ground.
The newer fence to the east is
standing and appears to be maybe
10 or 15 years old.

Prior Records of Cor.


1870 orig survey
1890 R.K. Whiteley set post (page 3 BK W-8)
1921 J. Curo set 3/4" x 10" Iron pipe for
Temp. cor. (page 566 C.W. Co. BK A)

Time spent 1 hr.

OCT 16, 1981
W. Bookler
Rick Marsh

(12)

C-D 21

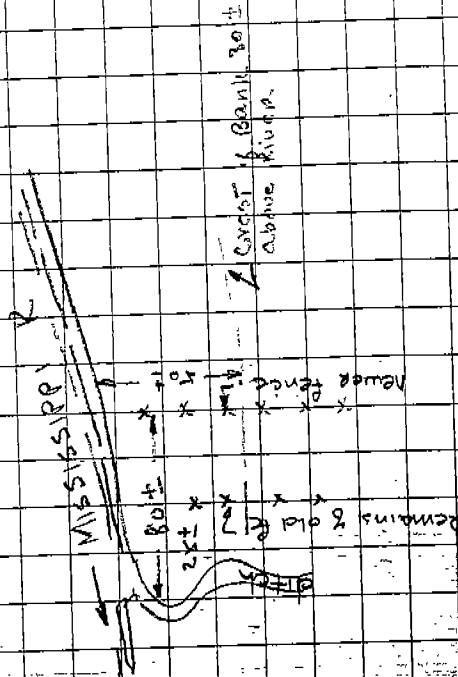

1/6 COR - NW COR SUB 1/4 - NW 1/4 SEC 12 - 47-28

F-21


FD, 1 1/2" Rebar at surface
of Road, in line with d of Rd
To west and 2' west of d of
North-South Road.
Crew using co. Land Cor Records
indicate "information only" on
this corner.

Time spent: 1/2 hr.

(13)

Oct 16, 1981
W. Buckler,
Rich. Marsh.

F-21 1/16 COR.

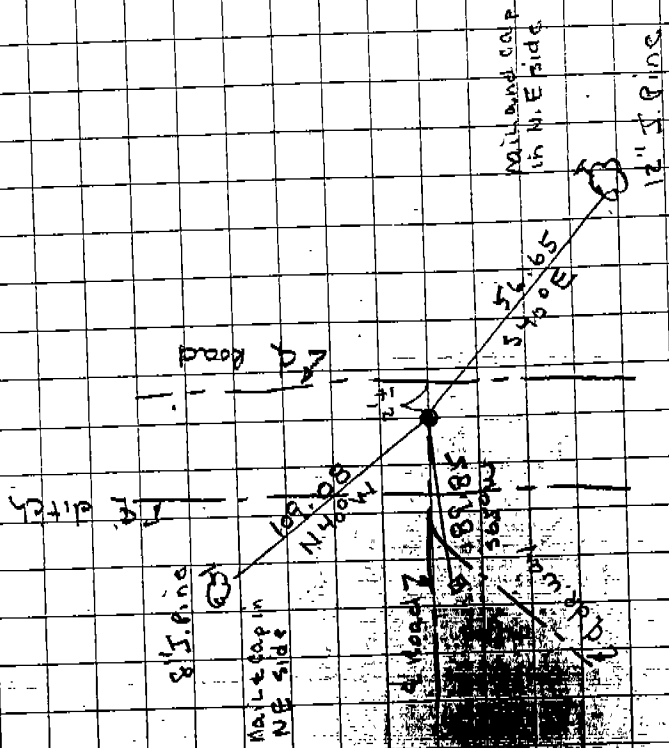

12" I.P. line

NORTH 1/4 COR SEC 11, TWP 47, RGE 28

E-19

searched Area, with locator, no
mon found.

looked for orig Tam Tie pipe 8316
but no evidence found.

It appears that Road originally
had a sharper corner and that
when it was moved south the
Area was excavated to provide
fill for Road.

Prior Records of cor.


1870 Orig Post.

1922 I. Curo set 3/4" x 10" Iron for

Temp cor (Page 597 C.W. Co. Bk A)

Time spent 1/2 hr.

E-19

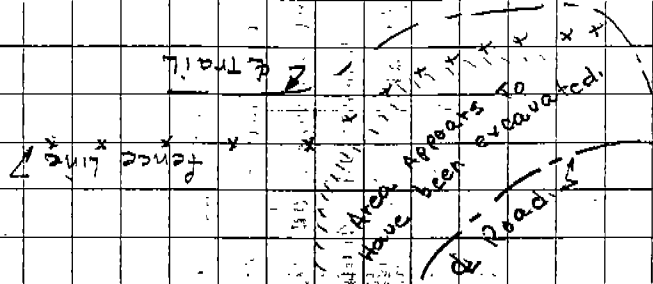

N

OCT 16, 1981
W. BUCKLER,
RICK MARSH.

Time spent 3 hrs.

⑤

Drainage of the

Summing up

11/15/67

6-21 West 1/4 cor sec 12, Twp 47, R5E 23B

searched Area with location No Monument or evidence of prior Neighbors found.

Measured dist from East Iron Mon
 pt in glass at sub. cor sec 12 to
 the 1/2" Rebar at NW cor SW/4 NW

$$\frac{3963.63}{3} = 1321.21 \text{ x } 2 = 2642.42$$

Prior Records of cor.

1870 orig post

1890 R.K. Witley calls for post
 in glass. (page 3 BK W-3)


1921 T. Curo set 3/4" Iron Mon for Temp
 cor (page 556 G.W. Co. BK A)

Iron Mon

Oct 16, 1981
 W. Ducker,
 Black Marsh.

(16)

6-21

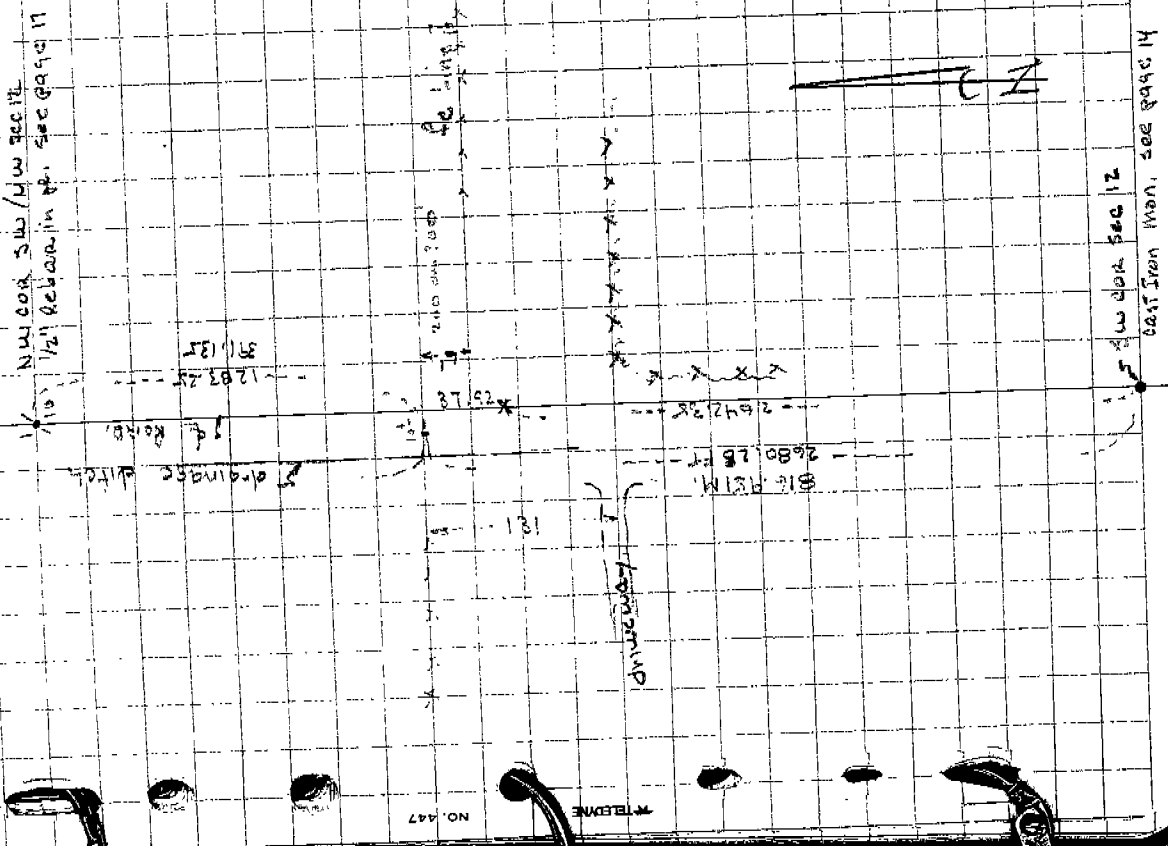

5

searched	Area w/ Locator	Found
----------	-----------------	-------

nail and disc in pole saw 18.2

spk on f	NG-11E	100'	(see	Draws m
----------	--------	------	------	---------

Co. Hwy Dept	File 32	Afw map, sheet 11428
--------------	---------	----------------------

set	spk	from Co. Hwy Dept.	Ties.
-----	-----	--------------------	-------

Prior Records of COA.

1870	orig. 1000
------	------------

1903	Garrison	(Page 87 C. R. Book)
------	----------	----------------------

1922	I. Curo	(Page 597 C.W. Co. Bk A)
------	---------	--------------------------

set 3/4" x 10" Temp.	Cor.
----------------------	------

1969	Crow w, co. Hwy dept	set	PK spk
------	----------------------	-----	--------

(file 32)	sheet	11428
-----------	-------	-------

certified by	Terry	Betley	2-26-86
--------------	-------	--------	---------


certificate no. 334

Time spent $1\frac{1}{2}$ hr.

52-5

⑤

Oct 16, 1981
W. Buckler
Kick Marsh

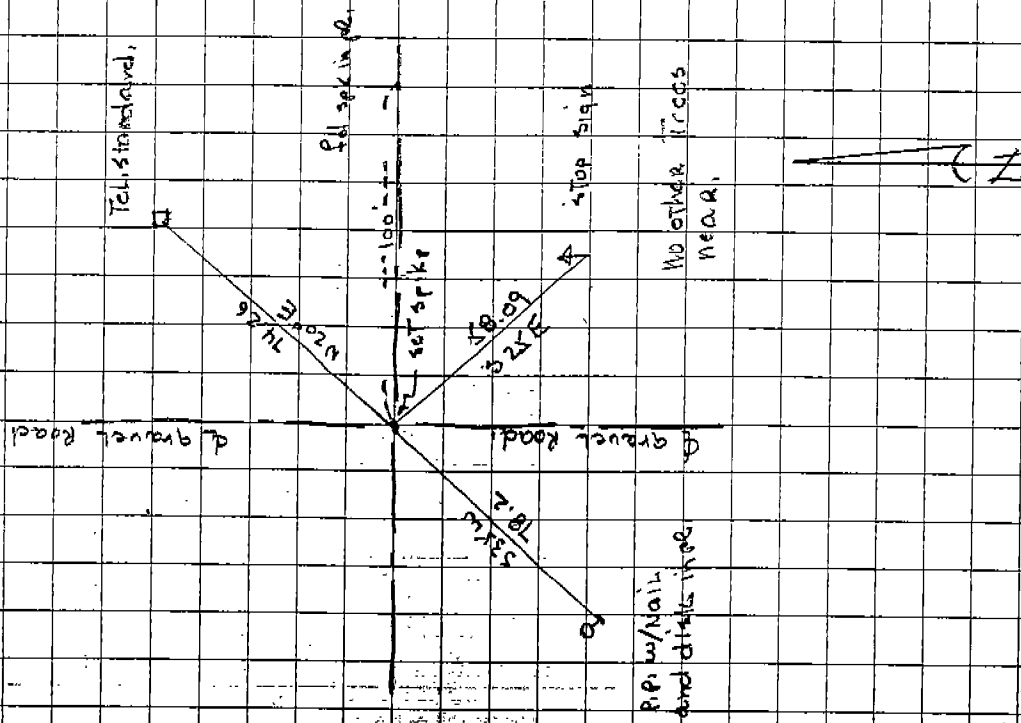

East 1/4 Cor Sec 13, Twp 47, Rge 28
L-25

Searched area w/ locator but
found nothing.


Talked to owner of the SE 1/4 Sec 13
and he said that the Dotzler's who
own the SE 1/4 had told him that
the box was south of the field
line.

See measurements on sketch.

Time spent 1/2 hr.

16 Oct. 1981
W. Bookler
R. Marsh.

L-25

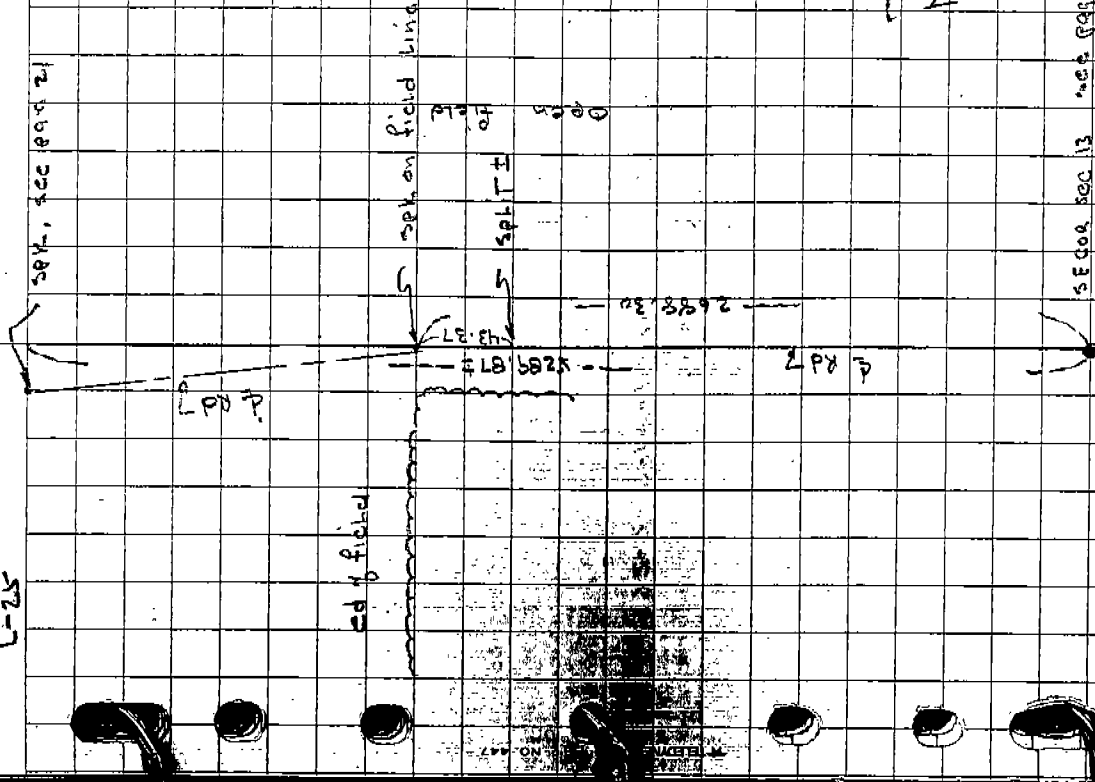

SE. 2nd 500 13 Twp 47, Rge 28

N-25

Found 1 1/2" Pipe in place on N. intersection of Roads down 3.

Prior Records of Cor.

1870 Orig. Post.

1903 Garrison (Page 36 C. R. Books) set Temp. for

1922 S. Curo set 3/4" x 10" Iron for Temp. Cor. (Page 157 C. W. Co. Bk. A)

Certified by Terry Betley 2-26-80

Certificate NO. 330

Time spent 1/2 hr.

19

March 1981

W. Buckner

2. March

5 sec set on field lines on 100'

N-25

4 462 2 513
4 462 2 513
4 462 2 513
4 462 2 513
4 462 2 513
4 462 2 513
4 462 2 513
4 462 2 513
4 462 2 513
4 462 2 513

guy pole, naive
disc in SW side

N 53° 41' 52"

P. 100' W/ B.T.
Tag
in Rd.

1 1/2" Pipe in Rd.
4 Rd

4 Rd

4 Rd

100' W/ B.T. Tag
4 Rd

8' Temp. w/
old blaze.
2 1/2" Tag on
lower blaze

no other trees ahead.



NO. 447

TELETYPE

East 1/4 COR SEC 24, T 47, R 9 S 28

P-25

found 1 1/2" pipe 0.5' below surface
of Road about 8' so of E. of Road
To west

Other Records of cor.

- 1870 orig post
- 1903 Garrison Rd orig post. (page 35 C.R. BK)
- 1890 R.K. Whiteley "set post" from d. B.T.


certified by Terry, Betty 2-26-86
Certificate NO. 331

Time spent 1/2 hr.

P-25

16 Oct 1981
W. Buckler
R. Marsh

(20)

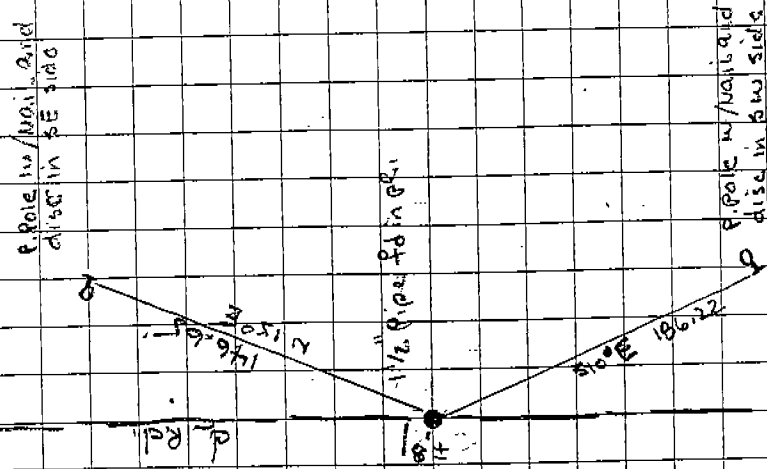

P. pole w/ nail and
disc in SW side

P. pole w/ nail and
disc in SE side

X-17

QUARTER CORNER COMMON TO
SEC 34 & 35 T47N R28W

Measured distance from 90.23
from SPK NW 1/4 to 1/2 mile
in place @ NW 1/4

181-01-40

181-01-30

2-03-00

MEASURED DISTANCE SOUTH TO
TOP PLACE @ NW 1/4
SEC 3 T46N R28W

Measured to North edge
of Swamp from SPK NW 1/4
Hedge line by Hems

I talked to Leroy Hems

who is approx 45 yrs old and has lived
in the area all his life. He told me

The Hedge line is the accepted
boundary as far as he knows.

Calculated split of distance
between two corners then measured

8" square of split and 1/2 mile to

Search for corner - No Evidence
Found. Time spent 2 hours

Record of Drive surveys:

1870 Post Set

3" ASPEN 336E 164K

8" BURR OAK N45W 312KS

1883-1888 RELF SET CORNER FROM 1019 BT

1890 RK WHITELEY SET POST FROM ORIG BT
IN GOOD ORDER.

2629.34

801.595

2629.90

90.48

807.019

269-12.40

2647.69

2647.44

1417.329

1467.61

1467.06

NE COR SEC 34 & 35

OCT 26, 1981

Tom Gaddlinghouse

Terry Savolanta

SUNNY 45° windy

2629.34

15

DRIVEWAY

Leary
Hem's
House

Hedge Line

NO. 447

SET SPK ON TOWN SHIP
ROAD
181-01-30

1467.06

South of SPK
to North edge of
Swamp

2647.44

X

X

X

X

X

X

X

X

X

X

V-13

CORNER COMMON TO
SECTIONS 27-28 & 33-34 T47N R26W

SEARCHED AREA WITH LOCATOR
Found 1/2" threaded BOLT 0' 15" BELOW
SURFACE OF ROAD. 2' SOUTH OF &
USED TIES ALREADY EXISTING.


- 1870 POST
- 6" SUGAR N 30 E 24 LKS
- 7" WHITE OAK N 19 W 17 LKS
- 7" WHITE OAK S 18 W 41 LKS
- 24" PINE S 20 E 34 LKS
- 1889 PK WHITELY 1st post in place
- 1890 PINE 1st post in place
- 1900 POST 52.7' 100' 187.5
- 1922 JOHN CURTIS 52.7' 34" x 10' 11cm
- 7" PINE N 45 E 46.8
- 5" OAK N 55 W 112.5
- 7" PINE 1st post in place 347 W 21 Z
- 24" STAMP. 50E 2997

Time Spent 2 hours

OCT 26, 1981
TOM GARLINGHOUSE
TERRY SAVALOTA
45° SUNNY WINDY

V-13

22

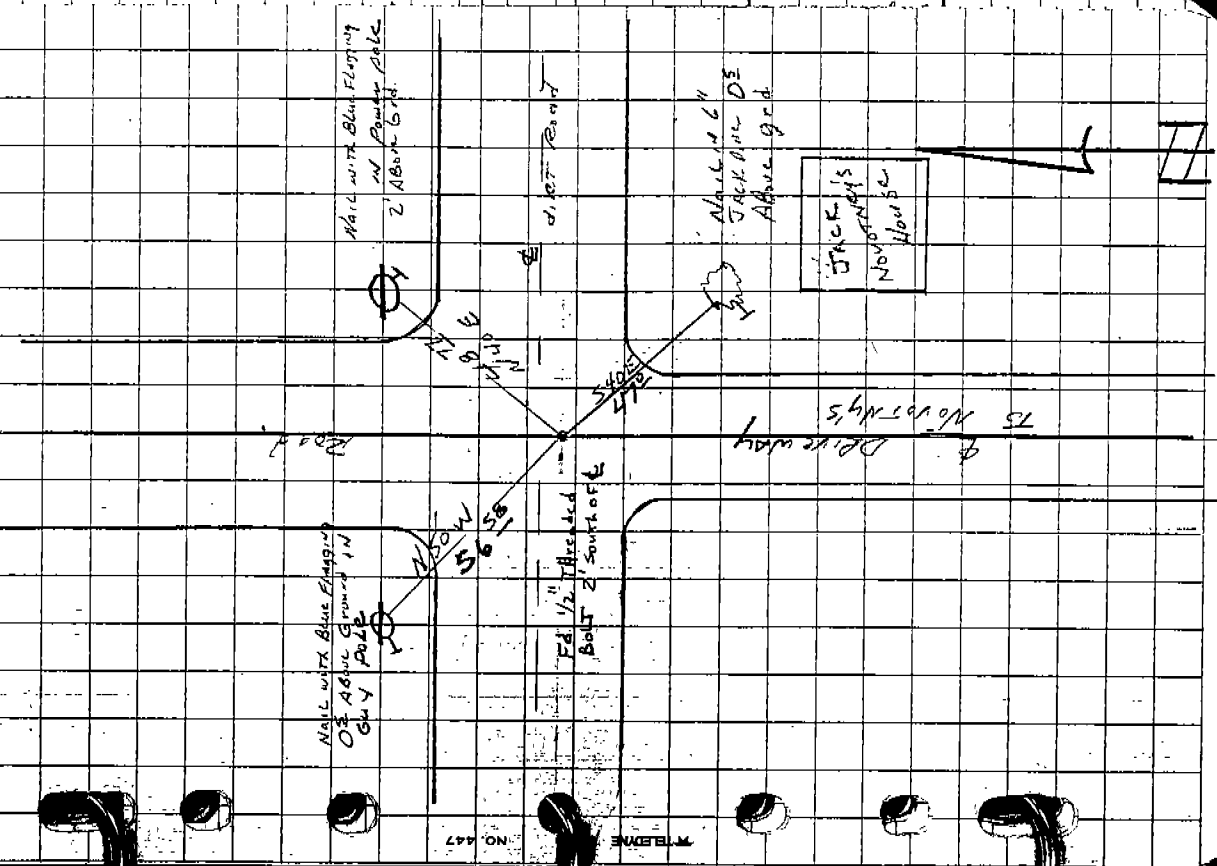

V-19

Quarter Corner Compared To Sections 24 & 35
T-47N R-28W

Searched For Corner in TAR

Road Nothing Found

1870 Post Set

5" ASPHALT N 36 E 18 LR

5" ASPHALT N 41 E 21 LR

1890- RK Whitely

Set Post 1/2 Corn Orig B75

Looked For Original Ties

No Evidence of them found


Time Spent 1 hour

OCT 27, 1981
Tom Garling house
Terry Savalota

23

35° Sunny

V-19

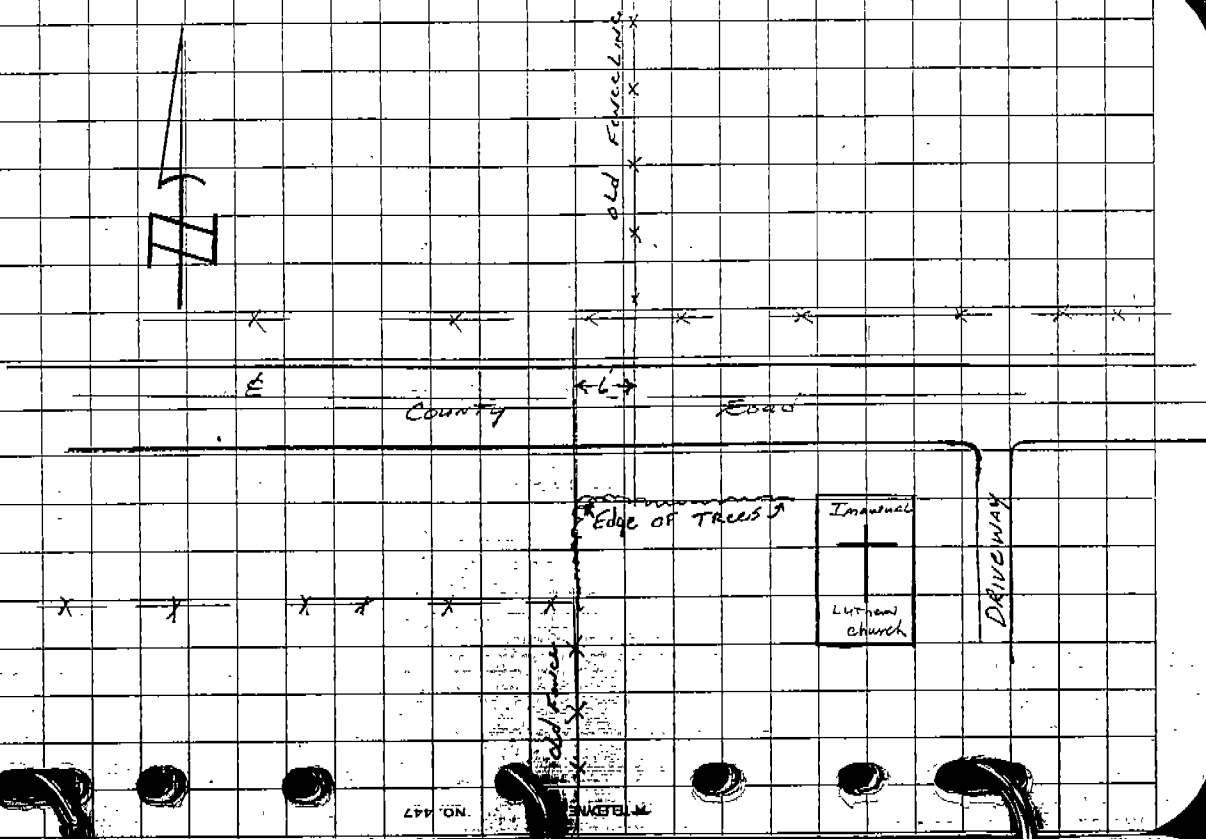

V-17

Section
Corner

Continue to sections 26-27-34-35
Twp 47N R 28 W

Ed 1/2" pipe in place. Flush
with surface of the 4' west
side of

Noticed 1/2" pipe as we
were driving past so we
stopped and tied it out.
Flush with surface of
road.

Time spent 1/2 hour

(24)

OCT 21, 1981
Tom Gabel, Warehouse
Terry Savatka

35° Sunny

V-17

Dirt Road


Nail in NW side
of Power pole

Paved
Road

Ed 1/2" pipe in place
4' west of E
Paved
Road

Nail in 16"
white oak

IRON HUB
TOWN HALL

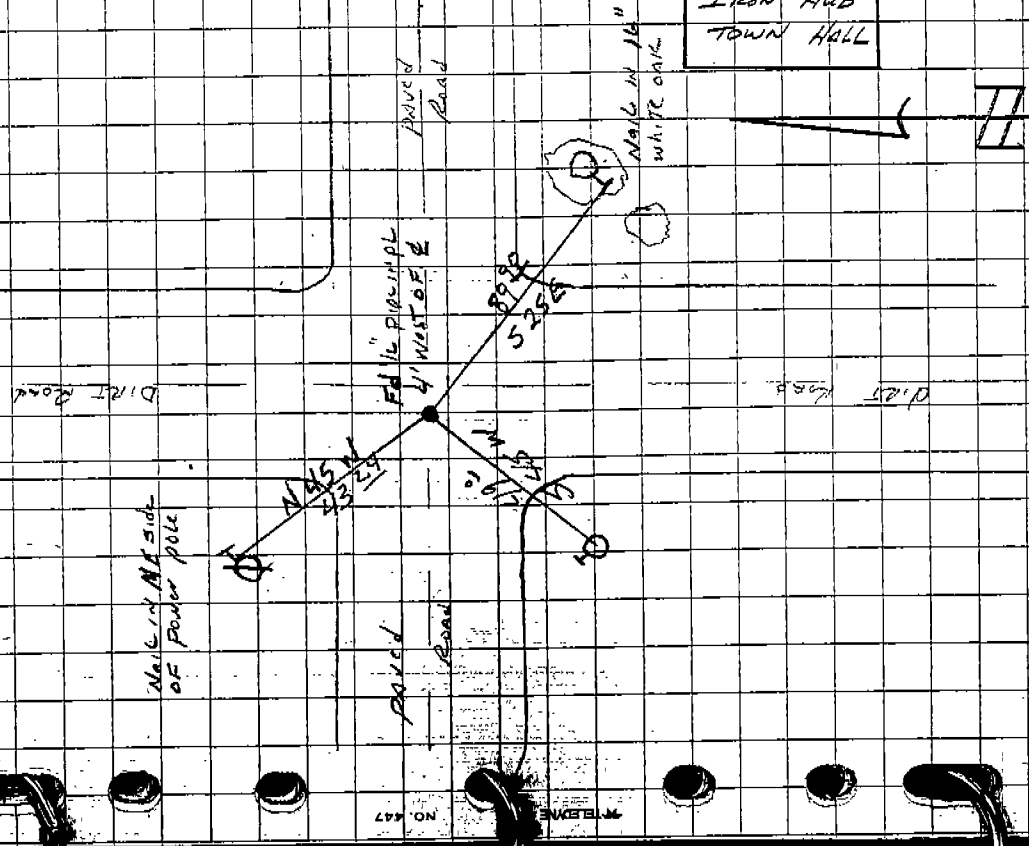

V-15

Quarter corner corner to Sec 27, 134

Ed 1/2" pipe in the Road
Flash with surface as we
were digging post so we
stopped and tied it out


Time spent 1/2 hour

Tom Gaskingshouse
Terry Savatoga

OCT 27, 1981
35° sunny

V-15

Nail in face of 20" ash
in top blaze

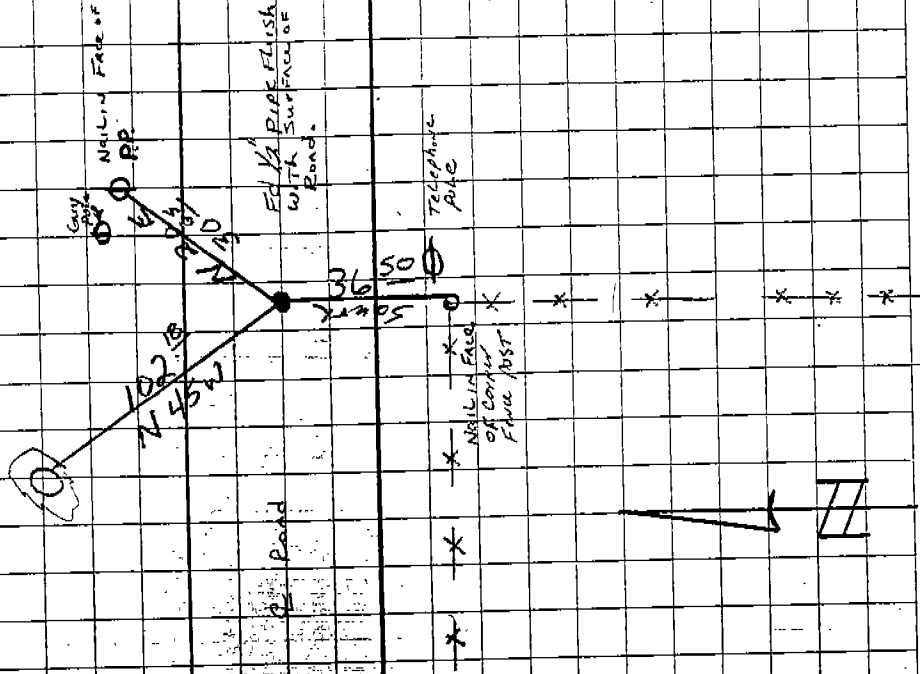

QUARTER CORNER Common To
SEC 27 T 28 R 47N R 28W

T-13

I TALKED TO LUTHER HOWARD
WHO SAID THE FENCE LINE RUNNING
EAST FROM THIS CORNER WAS
BUILT IN 1938 BY EARL SMITH
WHO USED TO LIVE AT THE LUTHER
HOWARD FARM UNTIL 1945. LUTHER
SAID THAT THE FENCE LINE IS
COMMONLY ACCEPTED AS THE PROPERTY
LINE. Tom Dooling

FOUND A LARGE PIECE OF AN OLD
CULVERT ON & AND EXTENDED FENCE LINE.
WE WERE UNABLE TO REMOVE THE
CULVERT PIECE'S FROM THE ROAD BED.
THIS AREA WAS BEEN FILLED WITH
LARGE AMOUNTS OF CLAY.

SET SPK ON & AND EXTENDED FENCE LINE
GOING EAST WHICH ALSO FITS FIELD
DIVISION LINE GOING WEST. PURPOSE
OF SETTING SPK. WAS TO PRECLUDE
LOCATION OF FENCE LINE AND FIELD LINE

NO EVIDENCE FOUND OF
ORIGINAL TIES BECAUSE OF
DISTURBANCE IN BUILDING ROAD.

ALSO TALKED TO HENRY MEARL WHO
HAS LIVED IN THE AREA FOR OVER 70 YEARS.
HE AGREED THAT THE FENCE LINE WAS THE
BOUNDARY

Continued on page 27

TOM GAELINGHOUSE
TERRY SAVALLOTTA

I talked to Healey Menzel

Who Told Me He Had No Knowledge

OF, ANY COUNTER POST IN THIS AREA

But there is a large line going

Fast which is nearly gone there

ARE JUST A FEW STAMPS WITH SALES

wire	Gravid into	them.
------	-------------	-------

The Area of the Road Has Been

Graded Recently And a lot of

dirt removed. we searched with

The Liberator, Vol. 1, No. 1, p. 1.

set God's presence

located off Fence Line going

East And of Road. Tied out 500

Henry who has lived on the farm

11.5.18 Over 70 years said that the

Fence Line Group 157 155 Bear

The Accepted Boundary

1870	Post 3 rd	12	OAK EAST DOCKS
------	----------------------	----	----------------

7" OAK N57W 24KPS


1883-85	Ref 587-0125T For comment
---------	---------------------------

1890	PK WHITE	SET DO	ST EA
------	----------	--------	-------

Handwritten: 1000

Time Spent on boxes

Quarter Corner Common To
Sec 33-34 T47 R28

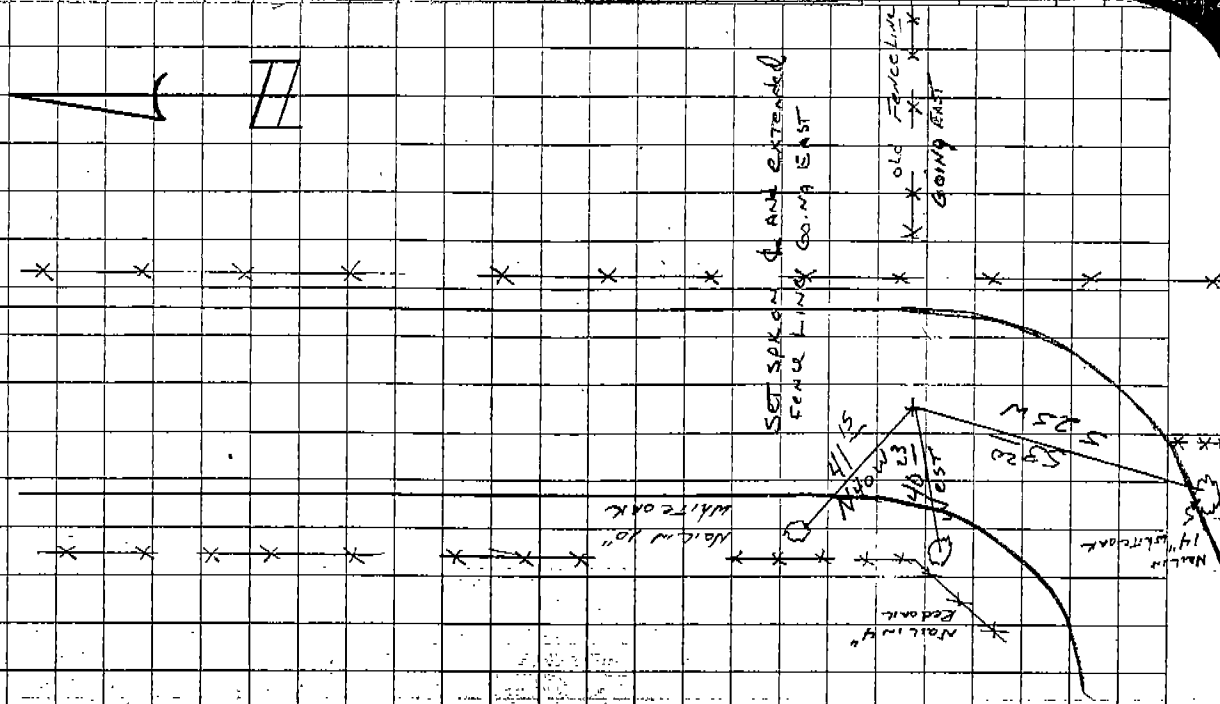

OCT 27, 1981

TOM GAELINGHOUSE
TERRY SAVALOJA

R-9

Fd 3 1/4" Iron pipe in place 1' west
of 0-75 below surface of
Road.


We found this pipe so
we would have a better idea
of how to locate the MC
on the east side of road
LAKA R 8 1/4.

There's a pipe 1 hour

CORNER COMMON TO
SECTIONS 20-21 & 28-29
T 47N R 28W

R-9

ROAD TO DENVER DRAIN
ON CORNER - LAKE



Nailhead
1/4" ASH

35' 10" E
N

35' 10" E
N

35' 10" E
N

EXISTING PLACE
NAIL IN PLACE
OF 1/2" Elm

NAIL IN 8" WHITE
ON K

OCT 27, 1981
Tom Gehringhouse
Terry Savalova

R-889

1870 Ties 12" pine 864E 20LK

12" pine N69E 27LK

1922 6" OAK N57E 59³ J. Curro 3er

8" OAK S56 1/2 E 71³ 8" STONK. FOR
TEMP CANTER

Fd 3/4" Iron pipe in place

on shore of Rabbit Lake. 0³ ABOVE

Ground. 17² EAST of shore

OF RABBIT LAKE.

Iron Spikes 1 per acre

MO ON EAST SHORE RABBIT LAKE
COMMON TO SECTIONS 20 & 29
T 47N R 28W

R-889

30

Nail in 6" ASH



22° ON

17° Pine

Ed 3/4" pipe in place

26 75

555E

79 20


570E

Nail in 8" Red Oak

Remains of old fence

Nail in 2" White Oak in face

RABBIT LAKE



OCT 28, 1981

R-16 TOM GARLINGHOUSE
TERRY SAVALLOTTA

Quarter Corner Common to Sec 22 & 27 T47N R28W

Measured intersection
East (Concrete Nail)

90-23 842.620

264.37 2764.49

(2764.43)

Measured west to conc.
Nail at intersection

210-16 785.893

89.41 2578.38

(2578.38)

Set concrete nail close to

Approx 1/4 cor measured to intersections

East and West to d-d to determine

split measured 93.04 East from

concrete nail found Fencing

going south from 1/2 way between

intersections. Staked area

thoroughly. No results.

1870 Post set

6" oak N 57W 8 LR

6" oak S 22E 111 LR

1921 J. Curto set 3/4" x 10" Iron

7" white pine N 12W 5 1/2

6" Poplar S 35W 37 1/2

Time spent 2 hours

CONC NAIL
AT INT. OF
R-15

2578.38

93.04

2764.43

COUNTY ROAD 30

DIRT ROAD

93.04 R-15

DIRT ROAD

CONC NAIL
AT INT. OF
R-15

OCT 28, 1981
TOM GARLING HOUSE
TERRY SAVALOJA

R-19

Measured East
to 1/2" P.M. AT
INTERSECTION

90-05 820.715
269-56 2692.63

Measured West
2 1/2" CONCRETE 1981
SET INTO SECTION

90-02 803.495
263-613
26
23
4

SEARCHED 28' EAST OF CONCRETE
Mark which was SET ON EXTENDED
FENCE LINE GOING SOUTH - NOTHING
FOUND

1870 POST WAS SET
12" ASPEN N 26 E 59 LK
3" ASPEN S 12 E 26 LK
1893 F.A. WHITELY SET IN PLACE
1922 JERRY SET 3 1/4" X 10" IRON

FOR TEMP CORNER
20" STAKE N 41 W 35 L
4" PIPER 532 W 27 E
1946 County Highway Dept. Ed


Now in place
5" B. OAK NE 51 L (Catawba)
5" B. OAK SE 48 L
NO TICS FOUND

Time spent 12 hours

Quarter Corner Common to SEC. 23 & 26 T47N
R20W


5' CONCRETE
SET INTO 4

R-19

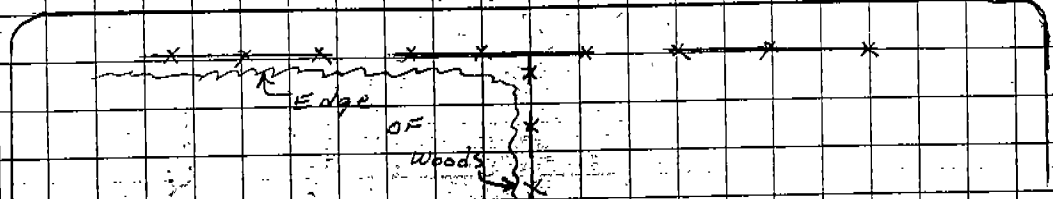

-2636 18-

-2692 63-

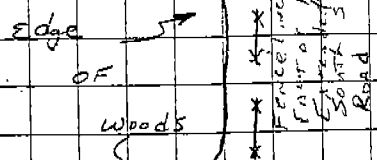

SET CONCRETE

FENCE LINE 15' LK
FACTOR OF PROTECTION
EAST OF FENCE
SOUTH SIDE OF
ROAD

T-25

E 1/4 Cor of Sec 25 / 47/28

Measured South

89-41

745.45

270-19

2445.71

Measured North

90-03

851.45

269-57

2793.47

2793.47

Measured distance North
From Spt to 1" pipe in place

178.05

1870

apost was set. These were made

3"

Tamarrak 534N 33 LKS

3"

Tamarrak 570E 41 LKS

1913

Krudson set monument

Ed 1" pipe in place in

E. of Township road 178.05 North

of Random Spt set to determine

Correct distance from NE cor

Sec 25 to SE cor Sec 25.

Certified by Terry Bentley 2-25-86

certif cate No. 333

Tim Spent 1 1/2 hours

OCT 29 1981

TOM GARLINGHOUSE

TERRY SAVALOJA

T-25

NE cor Sec 25

See page 33

34


Nail in west side
of power pole

NAIL CAP
IN TOP
OF FENCE POST

NAIL CAP
IN TOP
OF FENCE POST

NAIL CAP
IN TOP
OF FENCE POST

1/2" pipe in place

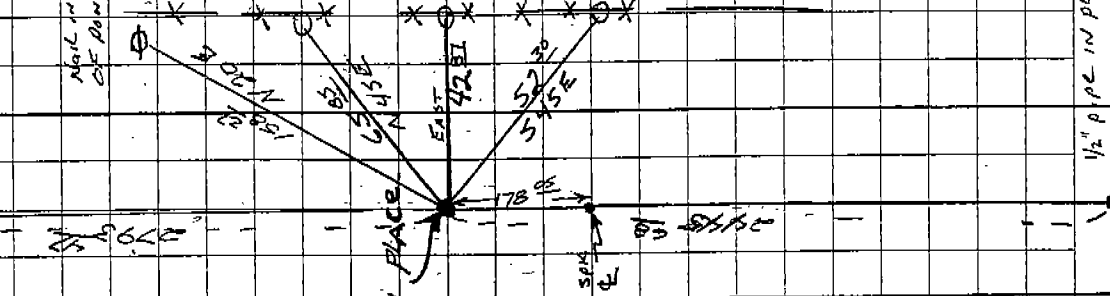

1/4 car common to 12813/47-28

Ed. God Spk in d Hwy

0670
POST SET

Ties	7"	Aspen	N 88 E	786 LK
------	----	-------	--------	--------

1971
T CARB SET 3/4" x 10" I.E.N

Fold Toward Center

4" Dope N 84E 86 1/2 FT

1810	7 th Period	Mod. S 45° W	33° - 45°
------	------------------------	--------------	-----------

1969.	Covering History dept 507
-------	---------------------------

1/2" Floor pipe.

7105	Power pole VME	172
------	----------------	-----

134" T.R. on pop. N 35E 125°

[illegible][illegible]

6-17-72

certified by Terry Beatty 2-21-86

29
3
4

OCT. 29, 1981

Tom Gallinhouse

Terry Savatka

7-23

Over

Neil, 4 Top

Telefonat
Nail, W
pedagog

→ take in the way of

Becky A

Time spent 2 hours

E-25

SE COR SEC

Two 47 RSC 28

1903

Garrison SET POST

Flora 0.9

Then BT Down & old post

5" Aspen 581E 64

5" Aspen N89W 69

did 46T 581E 64

TH 5 Coroner Because of

discovery of 46T 581E 64

decided to wait until winter

E-25

OCT 29, 1981

see page 45

Tom Galloway house

Terry Galloway


36

Quation corner continues to
SECTION 12-47-28
7-47-27
6-25

Ed. 1" pipe 17' E of Q of
DRIVEWAY SET BY HIRSH JENSEN
BILL BENCKE SAID HE RAN THE FENCE
LINE EAST FROM FOLLMER'S TO
THE APRAX. EAST 1/4 COR OF SECTION 12
WHICH RUNS 95' NORTH OF PIPE IN PLACE
TALKED TO HIRSH JENSEN
WHO SAID HE HAD SET THE PIPE
BY MISSTANDING WITH THE ST.
CORNER OF SEC 22 NORTH
2640. THEREFORE WE DID NOT
THE THIS PIPE OUT.
1870 POST SET
TIES 4" ASPEN S 44° E 60 LKS
3" ASPEN S 5° W 62 LKS
Sounded Fox corner and
Evidenced of 7 is nothing
Found.

Time Spent 2 1/2 hours

OCT 29, 1981
Tom Geringhouse
Terry Savacola

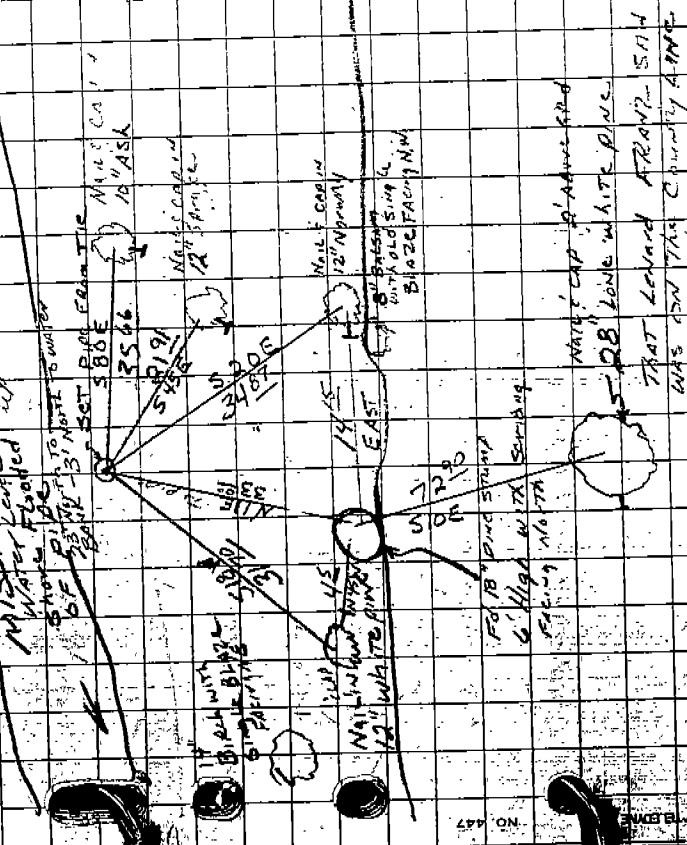

SET PIPE Nov 5, 1981
Tom Geringhouse
Terry Savacola

10/29/81 Time Spent 2 1/2 hours
11/5/81 Time Spent 4 hours
TOTAL 6 1/2 hours


OCTOBER 29, 1981
Tom Gaelling house
Terry Savala
13 & 24 T-47N R28W

N-23
Ed Aluminum capped pipe
on south edge of old field
Road with plastic cap Reg Number
#3091 Staked for curve
Reference pipe SW of capped
pipe.
1870 Post set
Ties 6" TAMARACK N85E 97S LK
1890 Whiteley established corner
1900 John Curro 54 3/4" x 10" IRON
Ties 7" post N27E 29G
1" x 10" IRON post 54SW 45E

Time spent 1 hour

G-25
OCT 29, 1981

Tom Gaelling house
Terry Savala
50° SW 1/4



Open
field

Extended Fossil Line
Run by Bill Stevens

Edge of wood

Newly
constructed

Pipe set
By HENI
JENSEN

Road

Old Fossil Line

NO. 447

37

End of
Fossil Line

33' WEST TO
Edge of Tons

17 1/2'

Extended Fossil Line

N-23

52

10" Ladder 571E 301K (1980)

I TALKED TO LORENZO FLANZ WHO
SAID THAT THE 28" LONG WHITE PINE
IN THE FIELD SOUTH OF THE RIVER
IS ON THE ARDEN COUNTY LINE.
HE HAD NEVER SEEN THE PINE STUMP
THAT HE FOUND ON THE BACK OF THE
RIVER. SEARCHED FOR PIPE WITH

Location	33' N 1/2 E 1/4 Sec 31 T18N R10E	No Evidence
Found	OF ASH TREE MARKED FOR CONSERVATION	
	100 YARD FROM? HAS LIVED ON THIS	

Farm For 64 years. He said

WAS FURTHER TOLD THAT THE PINE
WOODS ON THE COUNTY LINE.

Set 1/2" pipe with cap Reg # 9672

Made Ties.	dist To water = 3'	dist To
------------	--------------------	---------

Shore of River = 23'

ALL TINS ME

ALL THINGS MEASURED	HORIZONTALITY
---------------------	---------------


ALL THINGS MEASURED	HORIZONTALITY
---------------------	---------------

See pictures of Orig 1870 Big Tree


1370 8" ASH Tree marked for removal

Found - 12" Pine S 11 W 50 LKS

10" Lumber 5/16 304K

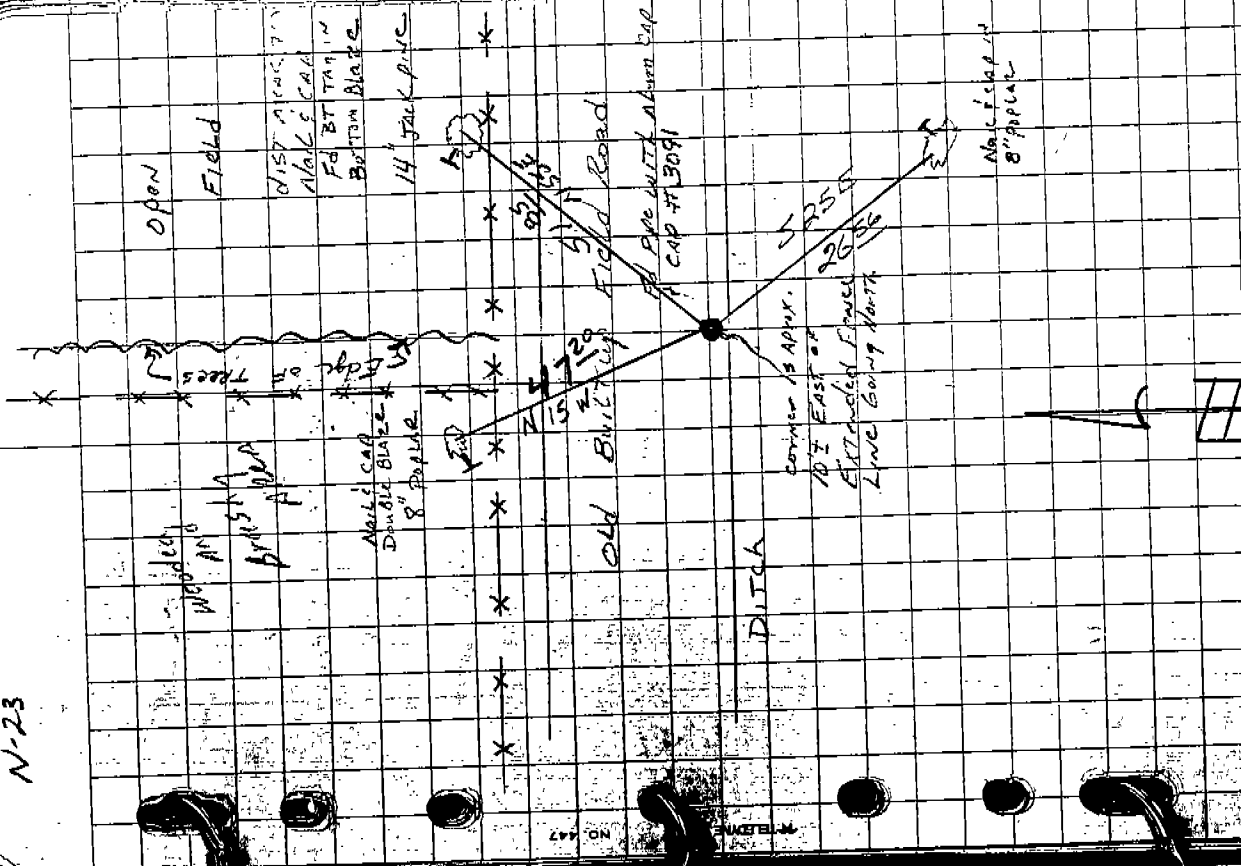

Nov 2, 1981
Tom Galt, Nephew
N-364 Terry Savolova

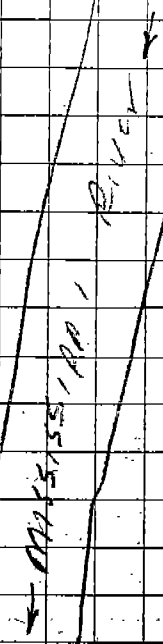

Searched For
MC ON
BANK OF
RIVER

Random Line Ran By
Wally Buckler

SE COR OF
SEC 18



MC ON South Line of Sec 18 T47N R28W
N-364

1870 12" PIPE 546E 444KS

7" PIPE N40E 44KS

Knudsen set from orig BT stump
1931 10" Norway pine on slope N45E 55
8" NP East 45"

Searched For MC on River Bank
Found Nothing - Wally Buckler's
Crew Had Been in the Area Before
We Ran a Random Line West
From the SE cor of Sec 18 to
Searched for this one.

Note: on Aug 14, 1978 W. Buckler Ran Random
line from N.E. Cor of Sec 19 west to
2" pipe at 1/16 cor (N-4) that was
set by Knudsen in 1934 (Knudsen Book
36 pages) sec Buckler Book 33 pages
W. 7. B

Time spent / hour

MN-5

MC common to sec 17E18 T47N R20W

Found 1 1/2" Iron pipe in place on North edge of clearing. Clearing has been made. 1 1/2" pipe lying in a small ravine SW of 1/2" pipe in place. The pipe we found in place on the edge of the clearing. Clearing is due to a distance from the river but it might have been set there because of the deep ravine that is cut through the bank. Going toward the river, perhaps more investigation could be gathered in Kinnison's notes of this area.


original
Ties 10x16" pine 500 F 36 LKS
Running
Notes 04" pine 546 W 250 LKS

Time spent 2 hours

(42)

Nov 2, 1981
Tom Gaskling house
Terry Savdloja
Clear calm 50°

MN-5

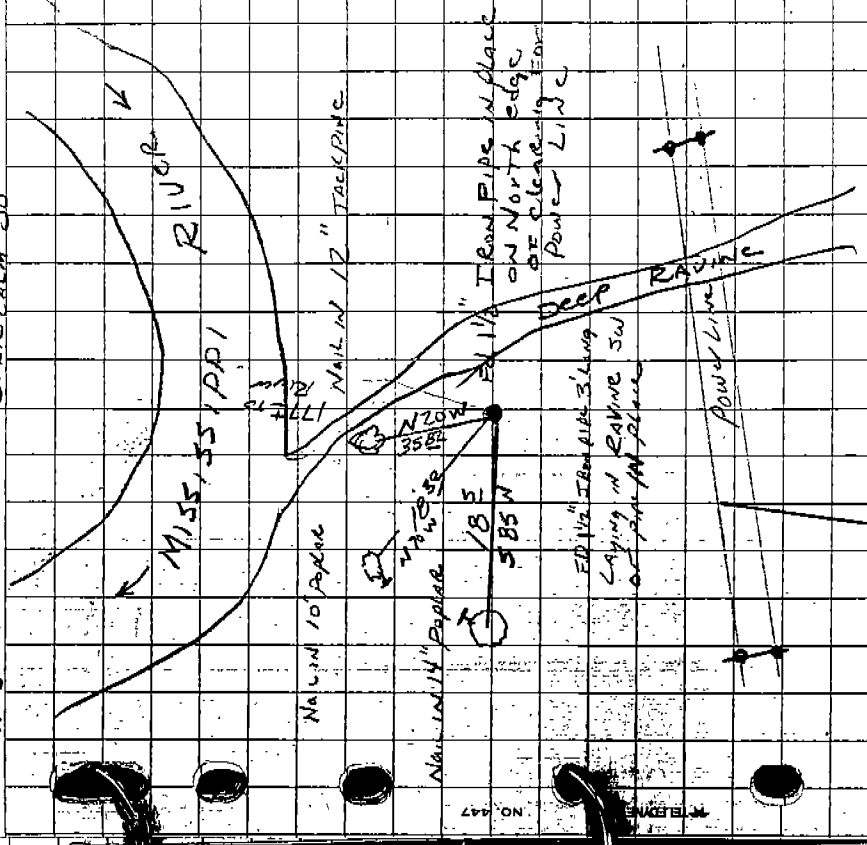

NO. 447

V-9

NE cor of sec 32 T47N R28W

1870

3" ASPEN N 45E 7 LK

3" ASPEN N 48W 31 LK

3" OAK S 86W 6 LK

3" ASPEN S 20E 14 LK

used quadrangle to get approx

location of search relative to

old mine dump road - covered

a large area surrounding the corner

nothing found

1889

RK building Ed post in place

1907

Rogers Brown Co. shows

iron pipe in place

see bracket pos 273

mine spent 1 1/2 hours

2 hours

V-9

Nov 2, 1981 Clear-Sunny

Tom Gaskins

Terry Suralaga

deeply rutted

woods road

NO. 447

old mine dump

old east west
mine line

R-23

Quarter Corner Contour to

Sec 24 & 25 T47 N R28W

Found 1" pipe in place with
4" Aluminum cap with 1/2" plastic
cap Reg # 3091.

1870 POST SET

TIES 4" ASPEN N 1/4 W 305 LK

4" TAMARACK S 1/4 W 144 LK5


1890 RK whiteley Set on line at
mid point.

1913 Louis Knudsen 305 LK5
ALSO To LARGE BRIDGE

TRAVERSE LK IN FIELD NORTH
OF CORNER. That had been
TORN OUT.

Time Spent 1 1/4 hour

Nov 2, 1981
Tom Geringhouse
TERRY SARALATA
R-23

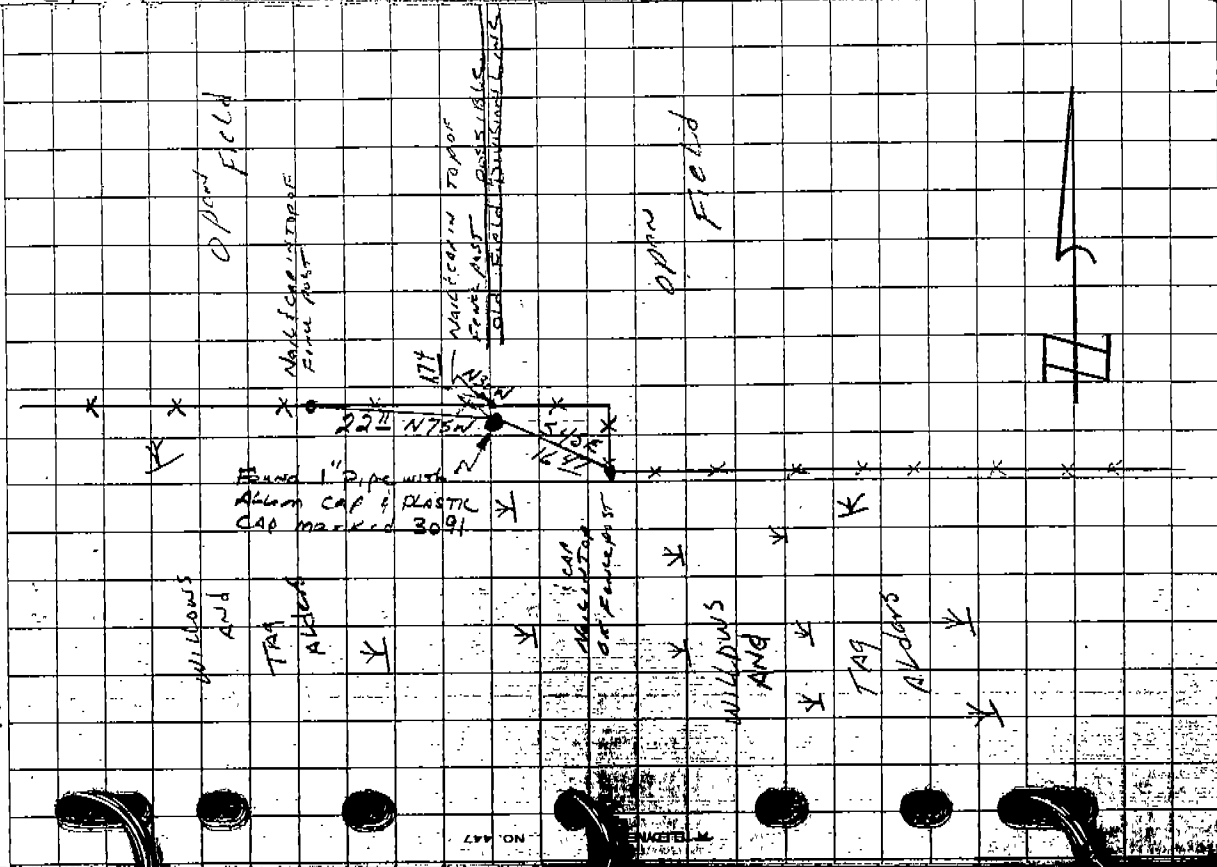

FAST 1/4 COR SECTION 32

X-9

POST SET

1870 4" OAK S 42° W 22 LKs

Ties 4" OAK EAST 19 LKs

1981 Fd 1" Solid pin 1 Above Ground

ON FENCE LINE. Going EAST TOWARD

POND EXTENDED WEST

LINE GOING EAST TOWARD POND

Bends AROUND TREES AS IT GOES

EXIST

1907 Rogers Brown Treats

CORNER AS LOST NO

Evidence Found set By
PROPORTION.

Note: see Rogers Brown orig work
SHEET W F BUCKLER FILES

Time Spent: 1 1/2 hours

(45)

X-9

Nov 2, 1981

Tom Gelling house

Terry Sawalata

NAIL CAP IN
10" WHITE OAK

NAIL CAP IN
12" RO


NAIL IN
12" TOWN
ROADS

N90E
938

Found 1" Solid pin
1 Above Ground

128± East to Pond
From 1" nail

Pond

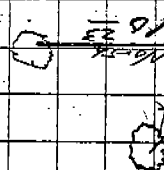

R-11

Quarter corner corner to sec. 21 28 47-20

1870 post

6" ASPEN 529 W 1940 12 54

6" ASPEN N 68 E 12 WAS 792

1887 RK white leg set post at midpoint

1981 Followed old RR grade to

Fence line going East Followed

Fence line to edge of flooded area

Running Nares don't seem to

Agree with USGS Topo Map comparing

location of small pond.

Water level of pond is

Quite a bit higher than

the past Area between

RR grade and pond that is

flooded in wet with

Dead white oak and

Dead Birch trees which indicate

that it was much drier

a few years ago - Because

of water we could not track

fence line East to corner

of 1/4 cor

Time spent 3 hours

R-11

Nov 3, 1981

Toad Creek house

Tracy Sakalaia

Sunny 65°



NO. 447

FIELD

old fence line

old RR grade

very brushy

Area of mixed hardwoods white oak & birch flooded area (quite deep)

Small pond

Area of mixed hardwoods white oak & birch flooded area (quite deep)

Area of mixed hardwoods white oak & birch flooded area (quite deep)

Area of mixed hardwoods white oak & birch flooded area (quite deep)

Area of mixed hardwoods white oak & birch flooded area (quite deep)

Area of mixed hardwoods white oak & birch flooded area (quite deep)

Area of mixed hardwoods white oak & birch flooded area (quite deep)

Area of mixed hardwoods white oak & birch flooded area (quite deep)

Area of mixed hardwoods white oak & birch flooded area (quite deep)

Area of mixed hardwoods white oak & birch flooded area (quite deep)

Area of mixed hardwoods white oak & birch flooded area (quite deep)

Area of mixed hardwoods white oak & birch flooded area (quite deep)

Area of mixed hardwoods white oak & birch flooded area (quite deep)

Area of mixed hardwoods white oak & birch flooded area (quite deep)

Area of mixed hardwoods white oak & birch flooded area (quite deep)

Area of mixed hardwoods white oak & birch flooded area (quite deep)

J-13

Nov 3, 1981

Tent Gearing house
Terry's car house
Sunny 65°

268
60

J-13

SW Cor of Sec 10 T47N R28W

1870 6" pine N34E 268' 0"

6" pine N34E 258 LKS

1921 12x12 Stone 45E 45' 0" Corner

Ties 8" stake N45E 45'

Top of 30" stake N81 1/2 W 53'

Top of 36" stake 57 1/4 W 41 1/2'

2" stake 54SE 45'

Could Not Reach Area

A Round Corner Meadow Flooded

1820m Beaver Dam on creek

2 hours

G-17

1870

Quarter corner Georgia to
Sec 10-11 T 49 R 28

Set

8" pine

N 43 E

601K

8" pine

601K

Seected the corner of

corner having found-

I talked to Henry

Tenison about this corner

He had no knowledge of

it being in place.

Time spent 2 1/2 hours


G-17

Nov 3, 1981

Tanase Longhouse

Terry Sarnola

Sunny 65°

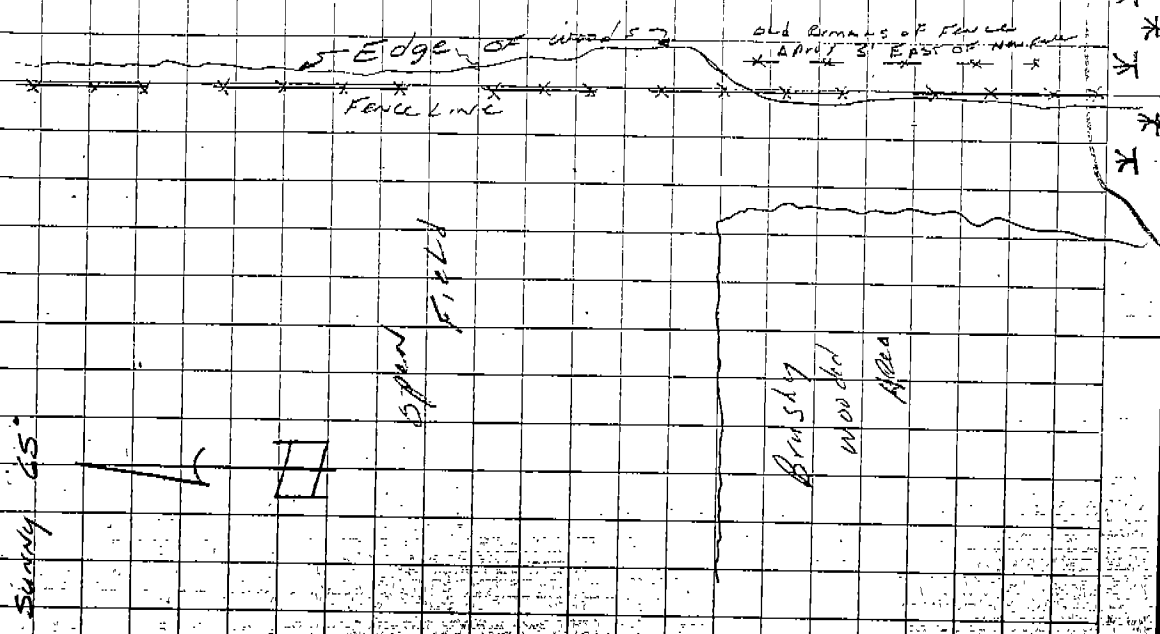

H-13

MC CORRECTION SEC 9 & 10 T47 R28

1870

Running Notes Listed Trees

12" Burr Oak 540 E 25 LKS

12" Maple 59 W 12 LKS

Found old N-S Fence line approx

130' $\frac{1}{2}$ WEST OF Creek where it empties

into the Mississippi Searched for

Original Bearing Trees - Most Trees in

the Area are Basswood and Elm

Time Spent 2 hours

H-13

49

Nov 4, 1981

Tom Gaskins house

Terry Sautter's

Cloudy 50°


MISSISSIPPI

River

150' from Gaskins house

Creek

TOP OF BANK ABOVE APPROX 50' SOUTH OF RIVER PLAN

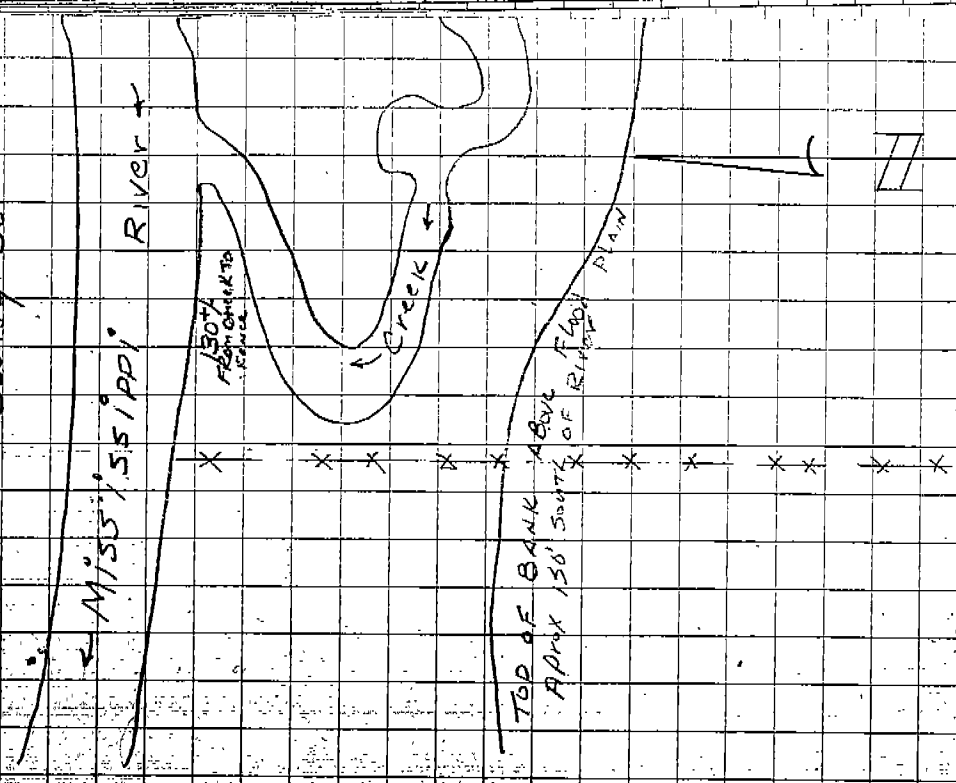

5-10/11

MC. Commence to see 9:16 / 747-28

1870

Ties to post 50T

10" Black Oak 522W 18CKS

12" Black Oak 172E 14CKS

Searched for Evidence of

Coiler in Area Around Drainage

Rake Found Several Oaks

Scattered in Area - None

That could be identified

As Bearing Trees

Time Spent 3 hours

50

Nov 4, 1981

Tom Gaskinhouse

TERRY SAVANNA

CLOUDY 50°

INTERMITTENT DRAINAGE RAIN

RIVER

MISSISSIPPI



T-15

Quarter corner commin to Sec 10 E 15
T 47 R 28 W

Talked to Huxley Jensen who
said the field was originally
Broke up and plowed in the 1920's
We found the fence corner at
the SE cor of the field
searched for remains of grain
and fur bearing trees. No dog
found. Huxley said the whole area
was burned over in 1918 and
almost all of the timber was
burned off. SET 3/4" pipe with
weir Reg Cap ~~PROTECT~~ corner of
field to preserve that location
of the corner

1870 post SET

12" ASPEN S44E 21LK


7" ASPEN N31E 52LK

Time spent 2 hours

J-15

(51)

Nov 4, 1981
Tom Gorking house
TERRY SAKALOVA
Cloudy 80°

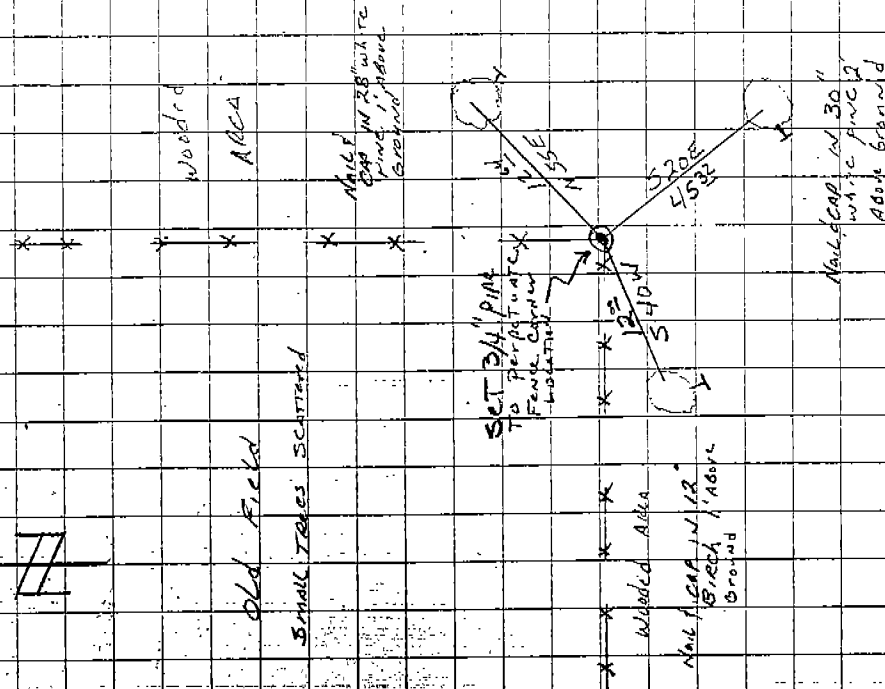

P-13

Quarry corner corner 21.123 T47-28

1870 4" Aspen 563 W 42 LKS 27¹²

8" Elm EAST 11 LKS 72.6

Rough TARD 2640± North

Farm & Highway to Fence

corner. Searched For

corner in Area Around

Fence corner to Evidence

of corner or Big Trees

Found.

Time Spent 12 hours


P-13

Nov 4, 1981

Tom Garlinghouse

Terry Sakaloff

cloudy 50°

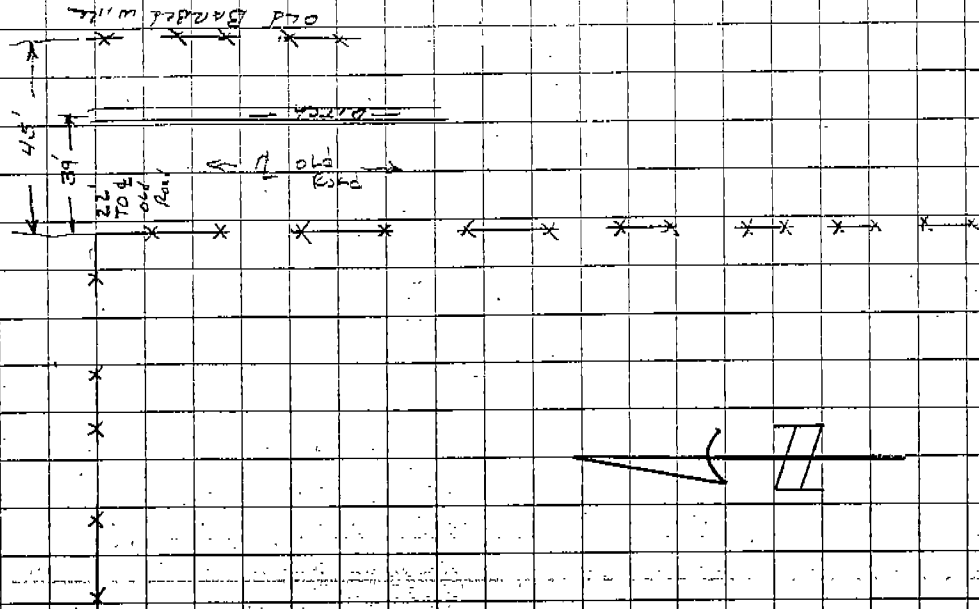

52

Nov 5, 1981

E-23

South 1/4 cor of sec 1 - 47-28

I talked to Frank Dordick
who said 40 years ago he had
found an old post that was
marked for 563. He also
said there was a fence corner
in this area also. It's
very sunny so it's the best
time to search for it. would
be in the winter when it's frozen
Frank Dordick lives in Sec 6 - 47-27
and has lived on the river for 50 yrs.

1870 post set

6" pine N54E 43 LKs

6" pine S48W 122 LKs

E-23

Nov 5, 1981
Tom Garlinghouse
Terry Sakaloga

See page 50 of S-120

Nov 5, 1981
Tom Garlinghouse
Perry Saunder

E-25

SE cor of SCC 1 - 47-28

I talked to Frank Dotler
about this corner. He said that
there is a fence corner in the area
that should be at or near the
section corner. Pete Peterson
also confirmed the fence corner
as the proper location for the
section corner. They both said
it was very swampy in this
area so we should probably
wait until winter to look
for this corner -

1 hour

E-25

see page 36

55

L-13

WOLFORD TAMP

1871

7" Elm

N 20 W 40 LKS

1935

10" Elm

N 69 E 3 LKS

KNUTSON

Searched For corner No

Evidence of corner or accessories
except for fence corner

Note: This cor. was searched for
in March of 1976 by Buckler and
a Traverser Ran from SW cor. of
sec 15 To area of cor. But no
cor was established. see Buckler
Field Book 19 page 70 and
Buckler File Number 210
W.F.B.

Time Spent 2 1/2 hours

56

L-13

MISSISSIPPI RIVER


Nov. 5, 1981

Tom Daniel - g house

Tony Jankovya

Remains of
old fence line

Remains of old fence line



K/L 13
MC Common
1871

WOLFEND TAMP
T-55-151/6 T 47-229W

20" PVC 562W 474KS
6" CLM 511E 62 LKS

1935 KNOTSON Apparently Ed. Mendenhall
According to Green using Co. Conder. Buried
Searched For cover No

Evidence of IT or the accessories
were found.

Note: This Cox was searched for in
March of 1976 by Buckler but no
evidence found.

WFB


Time spent 1 hour

Nov 5, 1981
Tom GaeLing house
Terry Savalora

K-L 13

← MISSISSIPPI RIVER ←

MC

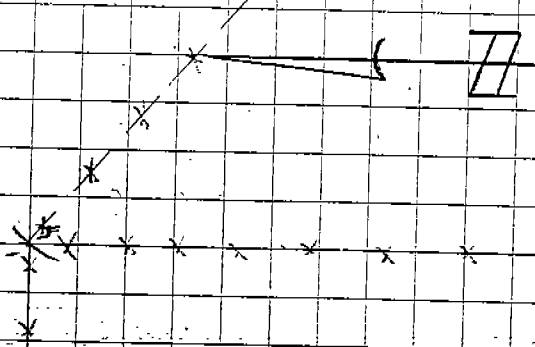

N 7/8

18" ELM N 75 E 66 feet (10 LK)
9" ELM 53 SE 33 feet 5 LK


did not have time to
check thoroughly.
1/2 hour

U-1-B

MC ON MISSISSIPPI RIVER BETWEEN
sec 17 & 20 T-47-29
Nov 5th, 1981

Tom Gering house
Tarry Springs, ALA.

MISSISSIPPI RIVER

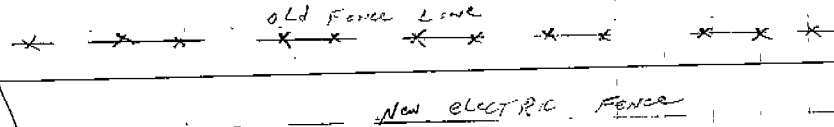

2-9

SW cor of SEC 33-47-29
1870 post set

20" Red pine N80W 81LK

20" Red pine S64W 58LK

7" Red oak N73E 39LK

7" Fir 566E 81LK

LE Garrison set post from

orig. BTS

1913 Knudson Fd in place

1930 Mining Co. Shows marked WFS pole

1952 Anderson corner in place

1965 DNR Lands & Minerals
Joe prepared set 3/4" Iron pipe

set over exist. iron which is

2' down New pipe is 03 down

PR 583E 962 TON 63W 461

8" Elm 548E 1082

1981 Found 1" Iron pipe 03 deep


Cap in Telephone pole N42W 46 43

Cap in Power pole 570E 96 82

Cap in 12" Poplar South 7186

Time spent 1 hour

Nov 12, 1981
Tom Garlinghouse
Steve Blawich
2-9 Terry Savatka

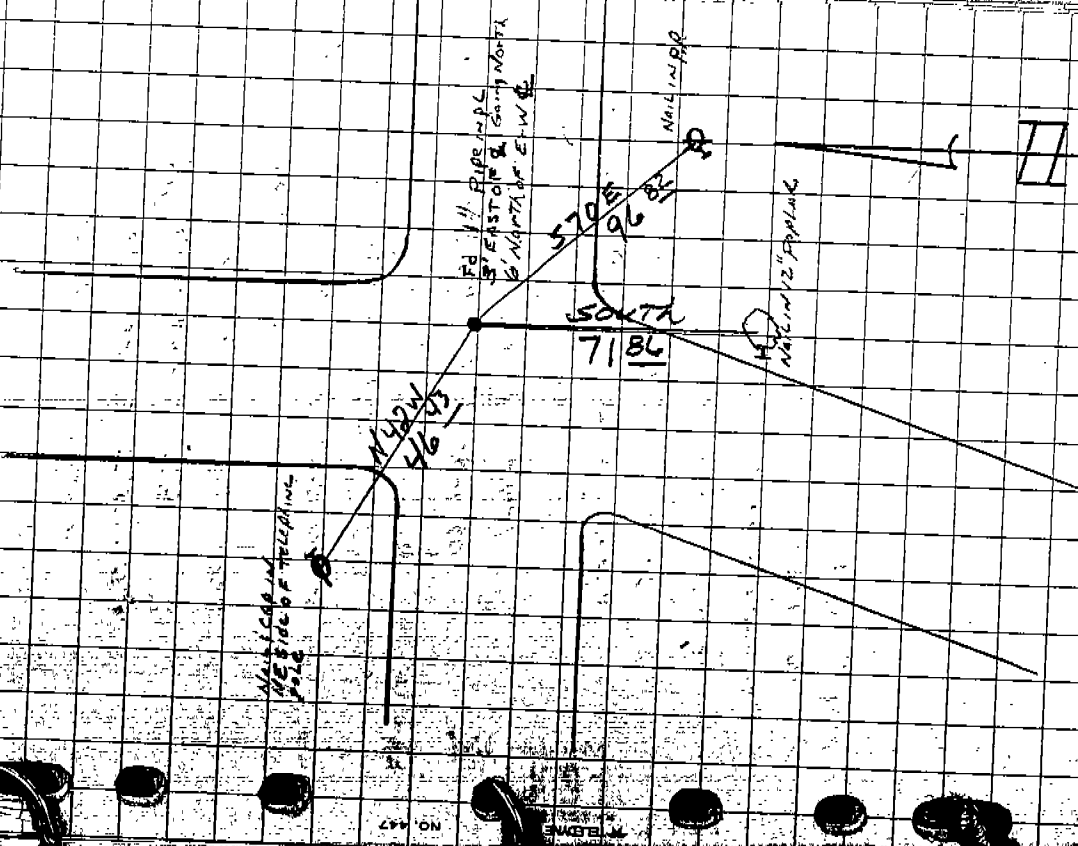

Z-11

Quartzite Corridor Containing To Sections

33/47/29-4/46/29

1870

POST SET

12" RED PINE S30W 52LK

8" RED PINE N36E 78LK

1903 LE GARRISON SET POST FROM

ORIG 875

1930 MINING CO. SHOWS MAN IN PLACE

IN W.F.B. FILE # 582

MEASURED EAST FROM 89.45-30 801.160

SW COR OF SEC 33

IN PLACE TO SETBACK

270-14

(2628.47)

FOR CORNER

SEARCHED WITH METAL LOCATOR

FOUND NOTHING ALSO SEARCHED

FOR ORIGINAL TIES NOTHING FOUND

ROAD HAS BEEN FILLED APPROX

10' WITH LEAN ORE FILL THROUGH

AREA FROM NATURAL GRADED

LEVEL

TIME SPENT 1 hour

Z-11

NOV. 12, 1981

TOM GADKINGHOUSE

STEVE BLAVICH

TERRY SAVALOGJA

Ed Temple

ROAD BED

FILLED WITH

LEAN ORE

TAILINGS

2628.47

County Road 34



Z-13

SE cor of Sec 33 - 47-29

1870 POST SET

8" ELM N46E 35LK

6" TRM N44W 41LK

7" ELM 550E 30LK

1903 LE GARRISON SET POST

FROM 1/4 NW-TH AND NW-NEST

1930 ± MINING CO. WEB FILE #582

Shows Mon in place

1942 CONCS KENNEDSON MON. IN PL

1965 JOE PUPICH (LAND MINERALS)

Ed 3/4" IRN PIN IN CONC

18" DOWN AT TIE of MARSHAL

10" B OAK 578E 92Y

12" ELM 533E 58⁸ FT

12" ELM N61W 86⁸ FT

1981 Ed 3/4" PIPE IN CONC 15 Below SURFACE

CAP: NAIL IN 14" ELM S35E 58⁶³

CAP: NAIL IN 16" ELM 582W 86⁷³

CAP: NAIL IN 14" WHITE OAK N60E 92³¹

PIPE IS AT THE NE CORNER OF A

SMALL TAILINGS DUMP THERE IS


A 2" X 6" PIPE WITH A YELLOW PAINTED

TOP, MARKING LOCATION OF MON.

TIME SPENT 1 hour

Nov 12, 1981
Tom Guelinghouse
Z-13 Steve Blavich

TENNY SAVATONA

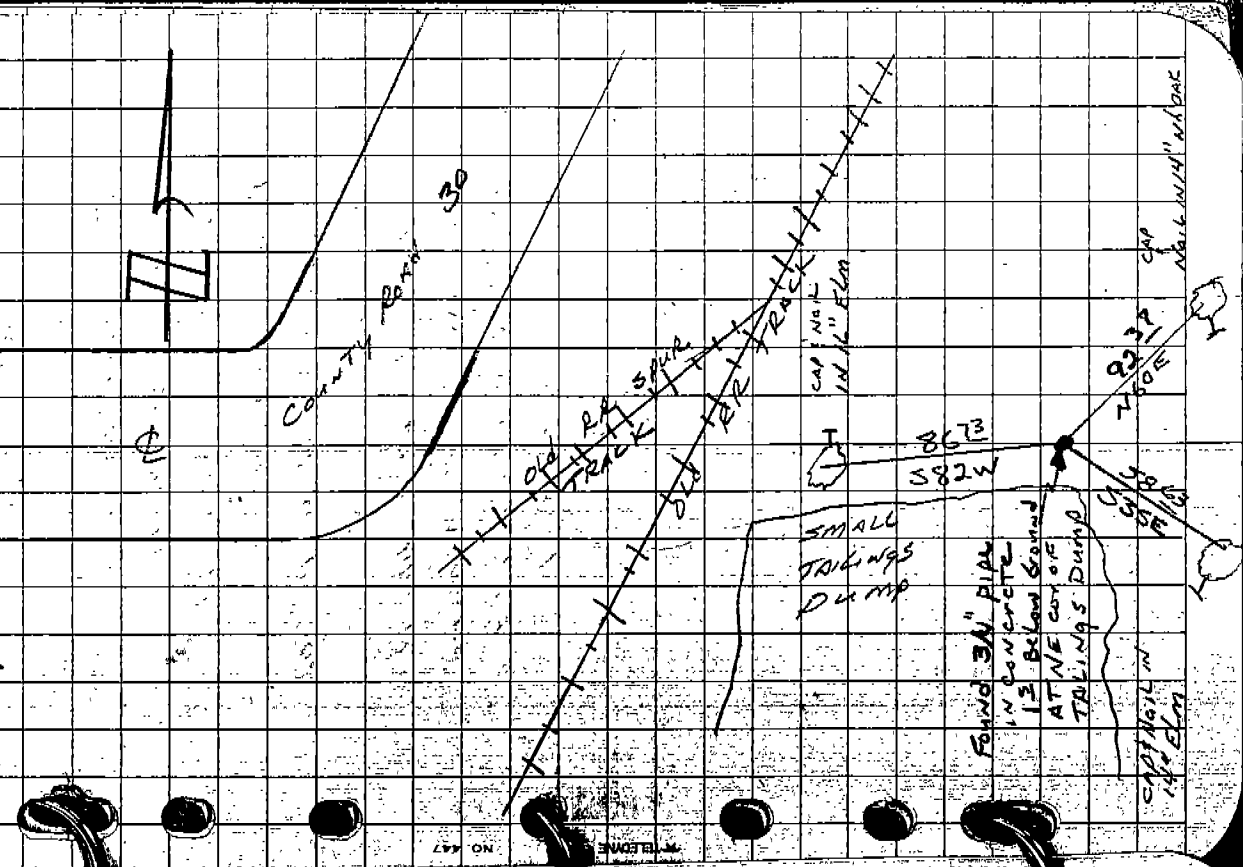

Z-7

Quarter Corner Common To Sections

32/47/29 & 5/46/29

1870 Post Set

28" pine N 73° W 27 LK

6" Ash 533 W 18 LK

1908 L E GARRISON SET or Fd A

1 1/4" x 20" Iron pipe

1930± Mining Co. (Rd B) W.F. # 582

Shows monument in place

1981 Fd 1" or 1 1/4" Iron pipe in p.

Top 1' bent west measured

Ties to base of pipe. Fd on

North edge of Road

Time Spent 1 hour

Z-7

Nov 12, 1981

Tom Garlinghouse

Terry Savakala

cap Steve Blawick

Nail in 12" Elm

2 1/2' above

Nail in 12" Elm

2 1/2' above ground

Nail in 12" Elm

2 1/2' above ground

Nail in 12" Elm

2 1/2' above ground

Nail in 12" Elm

2 1/2' above ground

Nail in 12" Elm

2 1/2' above ground

Nail in 12" Elm

2 1/2' above ground

Nail in 12" Elm

2 1/2' above ground

Nail in 12" Elm

2 1/2' above ground

Nail in 12" Elm

2 1/2' above ground

Nail in 12" Elm

2 1/2' above ground

Nail in 12" Elm

2 1/2' above ground

Nail in 12" Elm

2 1/2' above ground

Nail in 12" Elm

2 1/2' above ground

Z-5

SECTION CORNER COMMON TO

SECTIONS 31-32 / 47/29 AND

5-6 / 46-29

1870 POST SET

9" SPRUCE N55E 94K

5" SPRUCE S1/4 W 34K

6" ASH S62E 154K

16" YELLOW BIRCH N37W 284K

1903 LE GARRISON Fd. MON. IN PL.

1930 MINING COMPANY (R.I.D.)

WEA #582 SHOWS MON. IN PLACE

1952 DEAN ANDERSON - NAIL IN ROAD

BOOK 72 PAGE 8

1981 SEARCHED FIRE - NOTHING FOUND

NO TRAIL FOUND

THIRD SPEC. / hour

Z-5

NOV. 12, 1981

TOM GARLINGHOUSE

TECH. SASSALOTJA

STILLBURNICH

SEC 31

SEC 32

2' TOWNSHIP A ROAD

FD PEECS &
FLAGGING


SO. SIDE OF ROAD

IN APPROX AREA

SEC 6 OF CORNER SEC 5

Z-3

Nov 12, 1981
Tom Girdling House
Terry Girdling House
Steve Girdling

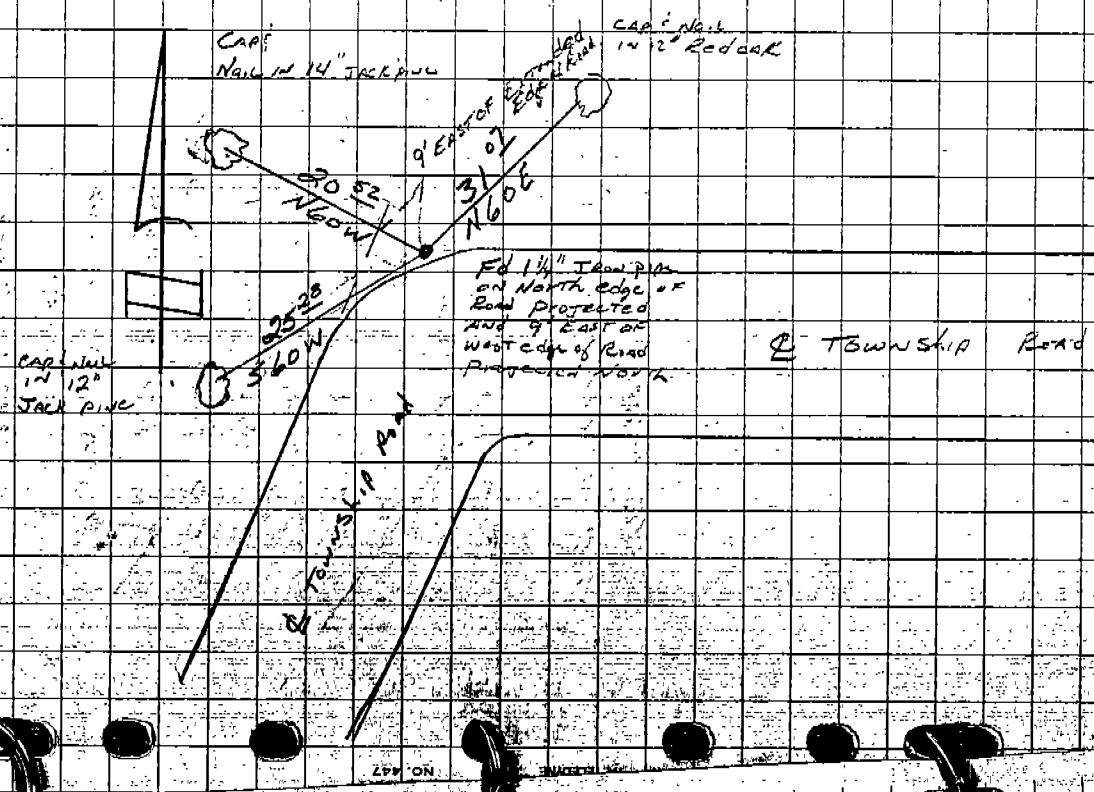

Z-3
South 1/4 cor of sec 31 -47-29

- 1870 POST SET
- 14" Red pine N61E 91LK
- 28" pine S28W 130LKS
- 1903 L.E. GARRISON Field or set post (RFB)
- 1930- MINING COMPANY (UNKNOWN)
- WEB FILE # 582 now in place
- 1952 Dean Anderson SET pipe
Page 7 Book 72
From April 1919 B.T.S. STUMPS
- 1965 DNR / LMS Joe Perperch
Ed 3/4" Iron pipe flush with
ground @ 90° Band in Red.
- 10" JACK pine S47W 25°
- 12" JACK pine N78W 20°
- 10" Red oak N48E 31°
- 1981 Found 1 1/4" pipe in place
on North edge of Road extended
at out side of curve DNR
BLAZED TPOCS STILL IN PLACE
Collection for biological trees
None found

Time spent 1 hour

V-13

SE corner Sec 28-47-29

1871

Post SE

3" ASPEN N47E 874K

3" ASPEN N40W 822K

5" WILLOW 523 192K

5" ASPEN S10E 394K

1898

E.E. Whiteley

Corner in place

1903

L.E. GARDNER SET POST

Found orig. ST.

His new tree 16" DBH OAK S13E 271K

1939

Found 1/2" iron pin 0.2" below ground

1st. post 1/2" iron pin 0.2" below ground

10" ASPEN N47E 909 FT

6" WILLOW OAK SE 597K

1942

LOUIS KENNEDY CORNER in place

3" KNOTS

1965

DNR LANDS MANAGEMENT INC. PROPERTY

Found 1/2" IRON PIN 0.2" below ground

1" ASPEN N47E 844

12" BARK EAST 617 FT

12" BARK 519 34E 985

1981

Found 12" BARK SE 985 FROM

LOCATION 35' W. SET. 1/2" IRON PIN

Found 1/2" IRON PIN 1/2" deep through tree

Ran out 25' 1 mile

Nov 12, 1931

TO M. GARDNER

V-13

SE corner Sec 28-47-29

Post SE

3" ASPEN N47E 874K

3" ASPEN N40W 822K

5" WILLOW 523 192K

5" ASPEN S10E 394K

E.E. Whiteley

Corner in place

L.E. GARDNER SET POST

Found orig. ST.

His new tree 16" DBH OAK S13E 271K

Found 1/2" iron pin 0.2" below ground

1st. post 1/2" iron pin 0.2" below ground

10" ASPEN N47E 909 FT

6" WILLOW OAK SE 597K

LOUIS KENNEDY CORNER in place

3" KNOTS

DNR LANDS MANAGEMENT INC. PROPERTY

Found 1/2" IRON PIN 0.2" below ground

1" ASPEN N47E 844

12" BARK EAST 617 FT

12" BARK 519 34E 985

Found 12" BARK SE 985 FROM

LOCATION 35' W. SET. 1/2" IRON PIN

Found 1/2" IRON PIN 1/2" deep through tree

Ran out 25' 1 mile

Note, we will need a longer extension post hole digger to get down to this cord.

4' west of the dug large hole 1 1/2' deep

Could not find post in hole in 1/2" hole

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep

Found 1/2" iron pin 1/2" deep